

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

#: 20214253

BUILDING NO. 119 S	STREET ADAMS STREET	CITY GLENDALE	ZIP 91205	Date of Inspection 09/04/2026	NUMBER OF PAGES 1 of 10
-----------------------	------------------------	------------------	--------------	----------------------------------	----------------------------

MY TERMITE COMPANY INC.
930 COLORADO BLVD. SUITE 1
LOS ANGELES CA 90041
818-940-0203- 323-258-5820
PR 7487



Ordered by:
BILL DAVIS
 119 S ADAMS STREET
 GLENDALE, CA 91205

Property Owner and/or Party of Interest
BILL DAVIS
 119 S ADAMS STREET
 GLENDALE, CA 91205

Report sent to:
BILL DAVIS
 119 S ADAMS STREET
 GLENDALE, CA 91205

COMPLETE REPORT ☒ LIMITED REPORT ☐ SUPPLEMENTAL REPORT ☐ REINSPECTION REPORT ☐

GENERAL DESCRIPTION:

MULTI FAMILY 2 STORY UNIT WITH A DETACHED GARAGE, COMP ROOF, WOOD EXTERIOR, RAISED FOUNDATION BASEMENT AND WAS VACANT AT THE TIME OF THE INSPECTION

Inspection Tag Posted:
None.


Other Tags Posted:

An inspection has been made of the structure(s) on the diagram in accordance with the the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.

Subterranean Termites ☒ Drywood Termites ☒ Fungus/Dryrot ☒ Other Findings ☒ Further Inspection ☒

If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items

Key: 1 = Subterranean Termites 2 = Drywood Termites 3 = Fungus/Dryrot 4 = Other Findings 5 = Further Inspection

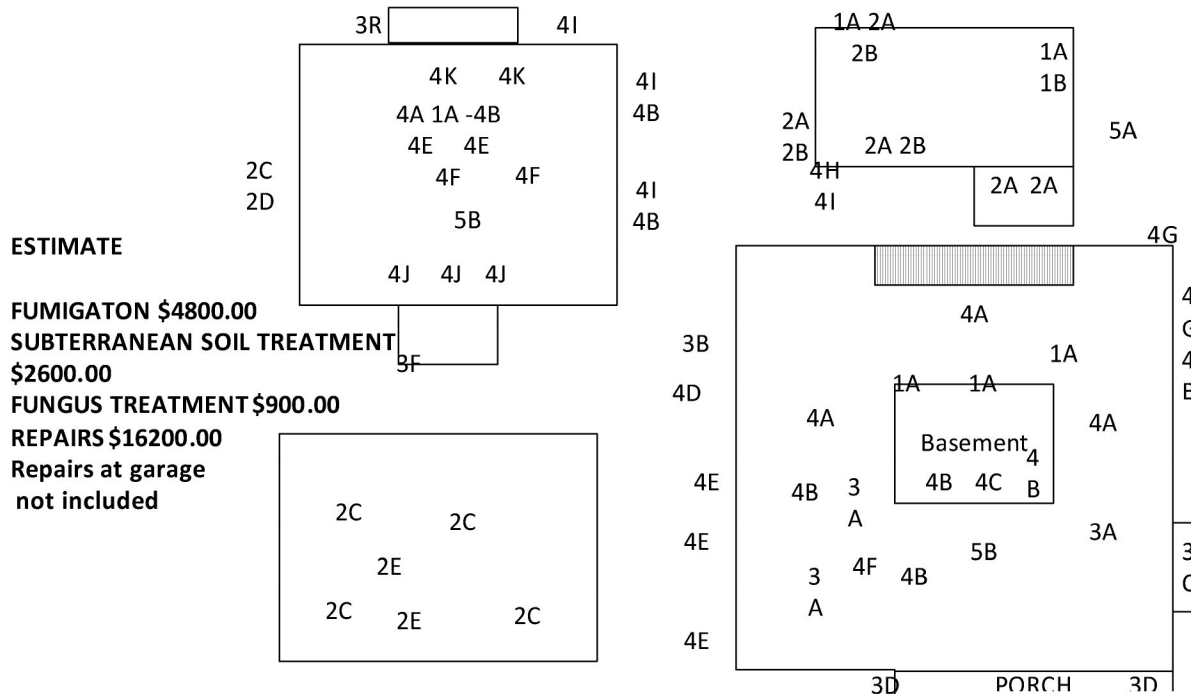

ESTIMATE

FUMIGATION \$4800.00

SUBTERRANEAN SOIL TREATMENT

\$2600.00

FUNGUS TREATMENT \$900.00

REPAIRS \$16200.00

Repairs at garage not included

Inspected By JOEL SANCHEZ License No. FR63613 Signature Joel Sanchez

You are entitled to obtain copies of all reports and completion notices on this property report to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California 95815-3831.

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov. (form t1a - 4/27/17) 43M-41 (Rev. 10/01)

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
119 S	ADAMS STREET	GLENDALE	91205	09/04/2026	2 of 10

NOTES, CAUTIONS AND DISCLAIMERS

The owner of this structure has specific responsibilities when it comes to maintenance and preventing the infestation of wood-destroying organisms. These maintenance procedures include, but are not limited to:

Reasonable cleaning and upkeep of roofs, gutters, and downspouts.

Regular painting and sealing of exposed surfaces.

Caulking around doors and windows or grouting around toilets, bathtubs, and shower enclosures.

Storing materials at least one foot away from the foundations of the structure.

Ensuring adequate ventilation within the structure.

Maintaining proper drainage away from the structure, including proper management of sprinkler systems.

Keeping soil levels below the top of foundations and preventing direct contact between soil and wood components of the structure(s).

By fulfilling these maintenance obligations, the owner can help deter wood-destroying organisms and contribute to the long-term preservation of the structure.

THE ROOF WAS NOT INSPECTED. If roof information is necessary, please contact the appropriate licensed tradesman.

The Structural Pest Control Board encourages competitive business practices among registered companies. Reports on this structure prepared by various registered companies should list the same findings (ie. Termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary from company to company. Therefore, you may wish to seek a second opinion since there may be alternative methods of correcting the findings listed on this report that may be less costly.

This property was inspected for visible and accessible evidence of wood destroying organisms such as wood rot by fungi. This inspection and report do not address fungi other than wood destroying fungi nor do they access the health impacts of any fungus including wood destroying fungi. We are neither qualified, authorized nor license to inspect for health-related fungi including molds, or to make an opinion as to health impact of any fungus, including wood rot fungi. If you desire information about the presence or absence of health-related fungi, including molds, you should contact a qualified industrial hygienist or other relevant health professional.

Molds, sometimes called mildew, are not wood destroying organisms. Branch 3 licensed do not have a duty under the Structural Pest Control Act and related regulations to classify molds as harmful to human health or not harmful to human health. This does not modify the Structural Pest Control or related regulations.

This company does not certify or guarantee against any leakage, such as (but not limited to) plumbing, appliances, walls, doors, windows, any type of seepage, roof or deck coverings. This company renders no guarantee, whatsoever, against any infection, infestation or any other adverse condition which may exist in such areas or may become visibly evident in such area after this date. Upon request, further inspection of these areas would be performed at an additional charge.

The Structural Pest Control Board encourages competitive business practices among registered companies. Reports on this structure prepared by various registered companies should list the same findings (ie. Termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary from company to company. Therefore, you may wish to seek a second opinion since there may be alternative methods of correcting the findings listed on this report that may be less costly.

MY TERMITE CO. INC. GUARANTEES ALL REPAIR WORK PERFORMED BY THIS COMPANY AS FOLLOWS:

REPAIRS 30 DAYS, FUMIGATION FOR 2 YEARS AND LOCAL TREATMENTS FOR 1 YEAR FROM THE DAY OF THE COMPLETION REPORT. THIS COMPANY IS NOT RESPONSIBLE FOR ANY FUTURE INFESTATION, DRY ROT OR ADVERSE CONDITIONS BEYOND THE TIME OF INSPECTION.

THIS COMPANY IS NOT RESONSIBLE FOR ANY RE-INFESTATION OF TERMITES OCCURRING FOR NOT REPAIRING ANY WOOD DAMAGE OR ANY SECTION 2 FINDINGS.

IF FUMIGATION IS PERFORMED, MY TERMITE COMPANY INC. IS NOT LIABLE FOR ANY DAMAGE TO SHRUBS, VINES, TREES, ETC. OR ANY DAMAGE TO ROOFS OR ROOF MEMBERS AT THE TIME OF FUMIGATION.

IN THE EVENT THAT A RE-TREATMENT, RE-FUMIGATION OR ANY OTHER REPAIR WORK IS TO BE PERFORMED TO HONOR A GUARANTEE ISSUED BY MY TERMITE COMPANY INC. THE HOME-OWNER IS RESPONSIBLE TO MAKE THE PROPERTY AVAILABLE FOR ANY WORK TO BE PERFORMED. MY TERMITE COMPANY INC. WILL NOT BE LIABLE FOR ANY COST OF VACATING OR PREPARING THE RESIDENCE FOR RE-TREATMENT, FUMIGATION OR REPAIRS.

NOTE: A new and/or extension of the guarantee is never given for re-treatments done under original guarantee.

NOTE: THIS INSPECTION HAS BEEN MADE WITH DILIGENCE AND COMPLIES FULLY WITH THE RULES OF THE STRUCTURAL PEST CONTROL BOARD ACT OF CALIFORNIA. THIS INSPECTION COVERS ONLY INFESTATION AND DAMAGE OF WOOD-DESTROYING ORGANISMS ON AREAS THAT ARE ACCESSIBLE AND VISIBLE UPON THE DATE OF THIS INSPECTION. THIS COMPANY ASSUMES NO RESPONSIBILITY OR LIABILITY FOR ANY INFESTATION OF INFECTION OR ADVERSE CONDITIONS WHICH WERE NOT VISIBLE OR ACCESSIBLE UPON THE DATE OF THIS INSPECTION.

SECTIONED REPORTING: This is a separated report which is defined as section 1 or section 2 conditions evident on the date of this inspection. Section 1 contains items where there is evidence of active infestation, infection or conditions that have resulted in or from infestation or infection on the date of inspection. Section 2 items are conditions deemed likely to lead to infestation or infection but where

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
119 S	ADAMS STREET	GLENDALE	91205	09/04/2026	3 of 10

no visible evidence of such was found on the date of inspection. Further inspection items are defined as recommendations to inspect the area(s) which during the original inspection did not allow the inspector access to complete his inspection and cannot be defined as Section 1 or Section 2.

1. SUBTERRANEAN TERMITES

ITEM NO. 1A (Section 1)

FINDING AND RECOMMENDATION: 1A Evidence of SUBTERRANEAN TERMITES in as indicated by 1A on the diagram. The evidence was located in or near: SUBFLOOR.

RECOMMENDATION: Topically treat subsoil with a registered termiticide for subterranean termites in accordance with the label.

ITEM NO. 1B (Section 1)

FINDING AND RECOMMENDATION: 1B Evidence of SUBTERRANEAN TERMITES in as indicated by 1B on the diagram. The evidence was located in or near: GARAGE.

RECOMMENDATION: Pressure treat infested area with a registered termiticide for subterranean termites in accordance with the label. Patch holes as practical if needed.

ITEM NO. 1C (Section 1)

FINDING AND RECOMMENDATION: 1C Evidence of SUBTERRANEAN TERMITE DAMAGE as indicated by 1C on the diagram. The damage was noted in or near: GARAGE.

RECOMMENDATION: Owner to hire proper tradesman to repair as necessary.

We highly recommend to repair all wood damage to avoid re-infestation.

2. DRYWOOD TERMITES

ITEM NO. 2A (Section 1)

FINDING AND RECOMMENDATION: 2A Evidence of DRYWOOD TERMITES as indicated by 2A on the diagram. Evidence noted in or near: GARAGE.-

RECOMMENDATION: Fumigate the structure for the control of Dry Wood Termites. The structure must be vacated for three (3) days. Refer to the fumigation notice for specific instructions. Vikane gas will be used for fumigation: (Active Ingredient -- Sulfuryl Fluoride -- with Chloropicrin as a Warning Agent. - Disclaimer: In order to prepare the property for fumigation, it's necessary for workmen to walk on the roof. We are informing you that possible damage may occur to the roof and/or tile roof. By giving the authorization to do the fumigation and/or termite work, you release My Termite Company from any responsibility for any damage to the roof and/or tile roof during the process of fumigation.- MY TERMITE CO. does NOT provide on-site security and does not assume any responsibility for the care and custody of the property in the event of vandalism or breaking and entering. -NOTE: In order for the fumigation to be performed, plant growth must be cut back and moved to create an approximately two feet clearance around the perimeter of the home. This is necessary to ensure sealing of tarping before the fumigation process can proceed. Fumigators are not allowed to move potted plants.

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
119 S	ADAMS STREET	GLENDALE	91205	09/04/2026	4 of 10

ITEM NO. 2B

(Section 1)

FINDING AND
RECOMMENDATION: 2B

DRYWOOD TERMITE DAMAGE indicated by 2B on diagram. The damage was noted in or near: GARAGE. Garage seems to be structurally compromised.

RECOMMENDATION: Owner to hire a licensed contractor to inspect and repair as necessary.

NOTE: We strongly recommend repairing all wood damage. Removing and/or repairing damaged wood eliminates pheromone scents that attract new colonies and prevents moisture absorption that leads to dry rot.

ITEM NO. 2C

(Section 1)

FINDING AND
RECOMMENDATION: 2C

Evidence of DRYWOOD TERMITES as indicated by 2C on the diagram. Evidence noted in or near: PROPERTY.-

RECOMMENDATION: Fumigate the structure for the control of Dry Wood Termites. The structure must be vacated for three (3) days. Refer to the fumigation notice for specific instructions. Vikane gas will be used for fumigation: (Active Ingredient -- Sulfuryl Fluoride -- with Chloropicrin as a Warning Agent. - Disclaimer: In order to prepare the property for fumigation, it's necessary for workmen to walk on the roof. We are informing you that possible damage may occur to the roof and/or tile roof. By giving the authorization to do the fumigation and/or termite work, you release My Termite Company from any responsibility for any damage to the roof and/or tile roof during the process of fumigation.- MY TERMITE CO. does NOT provide on-site security and does not assume any responsibility for the care and custody of the property in the event of vandalism or breaking and entering. -NOTE: In order for the fumigation to be performed, plant growth must be cut back and moved to create an approximately two feet clearance around the perimeter of the home. This is necessary to ensure sealing of tarping before the fumigation process can proceed. Fumigators are not allowed to move potted plants.

ITEM NO. 2D

(Section 1)

FINDING AND
RECOMMENDATION: 2D

DRYWOOD TERMITE DAMAGE indicated by 2D on diagram. The damage was noted in or near: TRIM. -

RECOMMENDATION: Patch with wood filler if wood members are not structurally weakened otherwise, remove and replace or reinforce with douglas fir or pine wood material and repair as required paint is not included. During the course of repair to damage timber, should damage extends into inaccessible areas a supplemental report will be issued.

ITEM NO. 2E

(Section 1)

FINDING AND
RECOMMENDATION: 2E

DRYWOOD TERMITE DAMAGE indicated by 2E on diagram. The damage was noted in or near: ATTIC. -

RECOMMENDATION: Patch with wood filler if wood members are not structurally weakened otherwise, remove and replace or reinforce with douglas fir or pine wood material and repair as required paint is not included. During the course of repair to damage timber, should damage extends into inaccessible areas a supplemental report will be issued.

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
119 S	ADAMS STREET	GLENDALE	91205	09/04/2026	5 of 10

3. FUNGUS OR DRYROT

ITEM NO. 3A

(Section 1)

FINDING AND
RECOMMENDATION: 3A

SURFACE FUNGUS noted as indicated by 3A on diagram. The FUNGUS infection was noted in or near: SUBFLOOR.

RECOMMENDATION: Wire brush surface fungus and apply a registered fungicide in accordance with the label.

ITEM NO. 3B

(Section 1)

FINDING AND
RECOMMENDATION: 3B

Dry rot noted as indicated by 3B on diagram. The Dry Rot was noted in or near: SIDING TRIM.

RECOMMENDATION: Patch with wood filler if wood members are not structurally weakened otherwise, remove and replace or reinforce with douglas fir or pine wood material and repair as required paint is not included.

During the course of repair to damage timber, should damage extends into inaccessible areas a supplemental report will be issued
We also recommend owner to hire a proper tradesman to correct any moisture condition that was conducive to fungus

ITEM NO. 3C

(Section 1)

FINDING AND
RECOMMENDATION: 3C

Moisture damage as indicated by 3C on the diagram. The damage was in or near CHIMENEY & FASCIA.

RECOMMENDATION: Owner to hire a proper tradesman to inspect and correct this condition.

ITEM NO. 3D

(Section 1)

FINDING AND
RECOMMENDATION: 3D

Moisture damage as indicated by 3D on the diagram. The damage was in or near POST AND THRESHOLD.

RECOMMENDATION: Owner to hire a proper tradesman to inspect and correct this condition.

ITEM NO. 3E

(Section 1)

FINDING AND
RECOMMENDATION: 3E

Dry rot & termite damage noted as indicated by 3E on diagram. The damage was noted in or near: TRIM.

RECOMMENDATION: Patch with wood filler if wood members are not structurally weakened otherwise, remove and replace or reinforce with douglas fir or pine wood material and repair as required paint is not included.

During the course of repair to damage timber, should damage extends into inaccessible areas a supplemental report will be issued
We also recommend owner to hire a proper tradesman to correct any moisture condition that was conducive to fungus

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
119 S	ADAMS STREET	GLENDALE	91205	09/04/2026	6 of 10

ITEM NO. 3F

(Section 1)

FINDING AND
RECOMMENDATION: 3F

Dry rot & termite damage noted as indicated by 3F on diagram. The damage was noted in or near: POSTS.

RECOMMENDATION: Patch with wood filler if wood members are not structurally weakened otherwise, remove and replace or reinforce with douglas fir or pine wood material and repair as required paint is not included.

During the course of repair to damage timber, should damage extends into inaccessible areas a supplemental report will be issued

We also recommend owner to hire a proper tradesman to correct any moisture condition that was conducive to fungus

4. OTHER FINDINGS

ITEM NO. 4A

CELLULOSE DEBRIS noted as 4A on the diagram.

RECOMMENDATION: Remove all rakable size cellulose debris and discard.

Note: Cellulose debris attracts termites & provides them with a food source, this condition can increase the risk of termites infestation in your home.

ITEM NO. 4B

(Section 2)

FINDING AND
RECOMMENDATION: 4B

EARTH TO WOOD CONTACT as indicated by 4B on the diagram. The contact was in or near: _.

RECOMMENDATION: Owner to hire a proper tradesman to break contact as appropriate.

NOTES: Earth to wood contact can attract subterranean termites. When wood comes into direct contact with soil, it creates a bridge for termites to access a building or structure easily.

NOTE: If this condition is not fixed we highly recommend to treat the area to prevent termites from infesting the hoouse. Call the office for an etstimate 818-940-0203

ITEM NO. 4C

(Section 2)

FINDING AND
RECOMMENDATION: 4C

Moisture damage as indicated by 4C on the diagram. The damage was in or near BASEMENT.

RECOMMENDATION: Owner to hire a proper tradesman to inspect and correct this condition.

ITEM NO. 4D

(Section 2)

FINDING AND
RECOMMENDATION: 4D

Moisture damage as indicated by 4D on the diagram. The damage was in or near FOUNDATION WALL.

RECOMMENDATION: Owner to hire a proper tradesman to inspect and correct this condition.

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
119 S	ADAMS STREET	GLENDALE	91205	09/04/2026	7 of 10

ITEM NO. 4E

(Section 2)

FINDING AND
RECOMMENDATION: 4E

Exposed wood noted as indicated by 4E on the diagram.

RECOMMENDATION: We highly recommend to paint or treat the exposed wood to prevent or minimize termite infestation.

NOTE: Termites are drawn to exposed wood because it's an easy food source, especially if it's untreated or unprotected by paint or sealants. Even after fumigation, termites can return if this problem isn't fixed, leading to re-infestation.

ITEM NO. 4F

(Section 2)

FINDING AND
RECOMMENDATION: 4F

Moisture damage as indicated by 4F on the diagram. The damage was in or near BATHTUB.

RECOMMENDATION: Owner to hire a proper tradesman to inspect and correct this condition.

ITEM NO. 4G

(Section 1)

FINDING AND
RECOMMENDATION: 4G

Moisture damage as indicated by 4G on the diagram. The damage was in or near SIDINGS.

RECOMMENDATION: Owner to hire a proper tradesman to inspect and correct this condition.

ITEM NO. 4H

(Section 2)

FINDING AND
RECOMMENDATION: 4H

Moisture damage as indicated by 4H on the diagram. The damage was in or near SUBFLOOR.

RECOMMENDATION: Owner to hire a proper tradesman to inspect and correct this condition.

ITEM NO. 4I

(Section 2)

FINDING AND
RECOMMENDATION: 4I

Evidence of a plumbing leak under the house as indicated by 4I on the diagram.

RECOMMENDATION: We recommend contacting an appropriate tradesman to correct this condition.

NOTE: Termites are attracted to moisture conditions. This condition is conducive to termite infestation in the future.

ITEM NO. 4J

(Section 2)

FINDING AND
RECOMMENDATION: 4J

Soft Floor noted as indicated by 4J on the diagram.

RECOMMENDATION: Owner to hire a proper tradesman to inspect and correct this condition.

Note: Moist environments are highly attractive to termites, creating ideal conditions for them to grow, spread rapidly, and potentially cause structural damage. In addition, excessive moisture can lead to fungus decay, wood rot, and other moisture-related issues that may compromise the integrity of the structure.

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
119 S	ADAMS STREET	GLENDALE	91205	09/04/2026	8 of 10

ITEM NO. 4K

Damaged Foundation as indicated by 4K on the diagram. This is considered as conducive to infestation.

RECOMMENDATION: We recommend to contact other trades to correct this condition.

5. FURTHER INSPECTION

ITEM NO. 5A

(Further Inspection)

FINDING AND
RECOMMENDATION: 5A

Zero lot line exists as indicated by 5A on the diagram.

RECOMMENDATION: FURTHER INSPECTION after owner makes area accessible.

NOTE: NEIGHBOR RELEASE FORM NEEDED FOR FUMIGATION.

ITEM NO. 5B

(Further Inspection)

FINDING AND
RECOMMENDATION: 5B

SUBAREA limited inspected due to low clearance as indicated by 5B on the diagram.

RECOMMENDATION: Periodic inspection and further inspection is recommended if any of these areas become accessible. Any future Wood destroying organisms would be outlined in a supplemental report. This company assumes no liability or responsibility for any damage or infestation in areas not inspected.

COMMENTS AND OTHER INFORMATION

NOTE: MY TERMITE CO. INC. DOES NOT WARRANTY LUMBER FROM CHECKING, CRACKING, TWISTING, OR WARPING. THIS IS A NATURAL OCCURRENCE AND CAN NOT BE STOPPED.

NOTE: IF BUILDING PERMITS ARE REQUIRED, IT IS THE HOMEOWNER'S OBLIGATION TO OBTAIN PERMITS AND COST, THEREFORE.

NOTE: MY TERMITE CO. INC. ASSUMES NO RESPONSIBILITY FOR DAMAGED OR INFESTATION ON AREAS NOT INSPECTED OR PARTIALLY INSPECTED. IF CONCEALED INFESTATION OR DAMAGE BECOME EVIDENT ON AREAS NOT INSPECTED OR PARTIALLY INSPECTED A SUPPLEMENTAL REPORT WILL BE ISSUE WITH A NEW PRICE FOR RECOMMENDATIONS.

NOTE: MY TERMITE CO. INC. DOES NOT GUARANTEE WORK PERFORMED BY OTHERS. SUCH WARRANTY SHOULD BE OBTAINED BY THOSE PERFORMING THE REPAIRS.

NOTE: FUMIGATORS ARE NO LONGER ALLOWED TO SHUT-OFF OR TURN ON ANY GAS LINES OR UTILITIES. THEREFORE, IS THE OWNER/AGENT RESPONSIBLE TO CALL THE GAS COMPANY AT (800) 427-2200 AT LESS 72HRS, PRIOR TO FUMIGATION. IF GAS IS NOT SHUT OFF AT THE TIME OF FUMIGATION, THE FUMIGATION WILL BE CANCEL AND A FEE MAY BE CHARGE.

MY TERMITE CO INC. WILL BE SUB-CONTRACT EITHER OF THE FOLLOWING FUMIGATION COMPANIES AT THE TIME OF CONTRACT SIGNED.

**BIG FOOT FUMIGATION. PR-8131
LONG COAST FUMIGATION PR-4597**

WE ARE INFORMING YOU THAT THE UTMOST CARE WILL BE TAKEN DURING THE FUMIGATION PROCESS, HOWEVER, WE ARE EXPLICITLY INFORMING YOU OF THE POSSIBLE DAMAGES THAT MAY OCCUR TO ANTENNA OR SATELLITE, WOOD SHINGLES, TILE ROOFS, OR ANY KIND OF ROOFS, ALSO GUTTERS, PLANTS, TREES, SHRUBS, OR ANY KIND OF PLANTS. DUE TO THE BRITTLE AND FRAGILE NATURE OF TILE ROOFS AND ROOF STRUCTURE AND THE NECESSITY OF WALKING ON ROOFS TO PLACE AND REMOVES THE TARPAULINS ON THE STRUCTURE, EXTENSIVE DAMAGE MAY OCCUR AND ANY OR ALL PLANTS THAT ARE TOO CLOSE TO THE STRUCTURE MAY BE DAMAGED, BROKEN OR MAY DIE. MY TERMITE CO. INC. ASSUMES NO RESPONSIBILITY OR LIABILITY FOR ANY DAMAGES THAT MAY OCCUR DURING THE FUMIGATION. THIS INCLUDES DAMAGES TO ANY TYPE OF ROOF, PLANTS, SATELLITES OR DISHES.

IF FUMIGATION IS RECOMMENDED, BUYERS AND SELLERS INITIALS ARE REQUIRED.

BUYER

DATE

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
119 S	ADAMS STREET	GLENDALE	91205	09/04/2026	9 of 10

SELLER DATE

Payment for the certification and/or work completed is due at the time of service performed. If any escrow is involved, payment is due within 30 days. Failure to pay according to terms will result in a late payment fee of \$50 and 5% interest until pay in full.

UNDER THE MECHANICS LIEN LAW (California Code of Civil Procedures, Section 1181 ET. Seq) Any contractor, subcontractor, labor supplier or another person who helps improve your property, but is not paid for his work or supplier, has the right to enforce a claim against your property. This means that, after a court hearing, your property could be sold by a court officer and proceeds of the sale used to satisfy the indebtedness. This can happen even if paid your own contractor in full if the sub-contractor; laborer or supplier remains unpaid.

In the case of non-payment by the owner, reasonable attorney's fees and cost of collection shall be paid by the owner or person ordering the work, whether suit be filed or not. A service charge of 2 percent, per month, will be charged on all balances over (30) days plus \$30 late payment fee.

ARBITRATION DISPUTE:

By relying on this wood destroying organisms report, you agree that any controversy or claim arising out of or relating to this inspection and/or this report shall be settled by arbitration in accordance with the construction industry arbitration rules of the American Arbitration Association, and judgment upon the award rendered by the arbitrator(s) may be entered in any court having jurisdiction thereof.

CHEMICAL APPLICATION NOTICE

We are required to provide you with the following information prior to application of Pesticides, Termiticides and/or Fungicides to your property. Please take a few moments to read and become familiar with the content:

CALIFORNIA STATE State law requires that you be given the following information: CAUTION-PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control Companies are registered and regulated by the Structural Pest Control Board and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the state finds that, based on existing scientific evidence, there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized.

"If within 24 hours following application you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center (800) 222-1222 and your pest control company immediately (323) 258-5820.

For additional information contact the county health department; County Agricultural Department and the Structural Pest Control Board, 2005 EVERGREEN ST. STE. #1500, Sacramento, ca. 95825-3280. TEL. (800) 737-8188

Chemical Notice: My Termite Company Inc. will use pesticide(s) specified below for the control of wood destroying pest or organisms in the location identified in the Structural Pest Control report as indicated above.

Fumigate with registered fumigant Sulfonyl fluoride or methyl bromide, dependent upon conditions at the size. Chloropicrin to be used as the warning agent. Check your post-re-entry notice for the fumigant used. Please note that affect overexposure for these materials can include the following: shortness of breath, double vision, unusual drowsiness and weakness, and tremors. Your health and safety are our major concern if you experience the symptoms as outlined here leave the structure immediately and call our office.

This pesticide(s) proposed to be used and the active ingredients(s) "X"

___ *Vikane: Ingredients: Sulfurylfluoride*

___ *Invader: Active Ingredients: Propoxuer*

___ *Termidor: Active Ingredients: fipronil*

___ *Premise: Active Ingredients: Imadacloprid: 1-6-cloro-3pyridiny- N-notro- 2imidazolidinimine.*

___ *Copper-green wood preservative; Active Ingredient: Disodium Octaborate tetrahydrate.*

___ *Timbor; Disodium ocataborate tetrahydrate*

___ *Dragnet; Permethrin*

___ *Bora-Care, Disodium ocataborate tetrahydrate*

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
119 S	ADAMS STREET	GLENDALE	91205	09/04/2026	10 of 10

____OTHER;_____

PESTICIDES ARE CONTROLLED SUBSTANCES USED TO CONTROL LIVING ORGANISMS AND VARY IN DEGREE OF TOXICITY. SANITATION, AS WELL AS PHYSICAL AND BIOLOGICAL CONTROL MEASURES, SHOULD BE CONSIDERED AS ANOTHER PART OF A GOOD PEST CONTROL PROGRAM. DURING ANY APPLICATIONS PESTICIDES, HUMANS AND PETS SHOULD NOT CONTACT TREATED SURFACES UNTIL THE SPRAY HAS DRIED.

For further information contact any of the following: STRUCTURAL PEST CONTROL BOARD (SPCB) at (800) 737-8188 or MY TERMITE CO. INC. (323) 258-5820

Ph#:County Health	Ag. Dept.	Poison Control
LA Co (213) 250-8055	(626) 575-5465	(800) 222-1222
OR Co (714) 834-5400	(714) 447-7100	(800) 222-1222
RV Co (951) 358-5000	(951) 369-4810	(800) 222-1222
SB Co (800) 782-4264	(909) 387-2105	(800) 222-1222
SD Co (619) 565-5764	(619) 694-2739	(800) 222-1222

Customer Signature

My Termite Company INC.

OUR ESTIMATE IS GOOD FOR 30 DAYS FROM THE BID DATE AND IS SUBJECT TO REVIEW AT THE TIME.

To order the work please contact us: Office 323-258-5820 Text 818-940-0203 Email: mytermiteco@gmail.com