




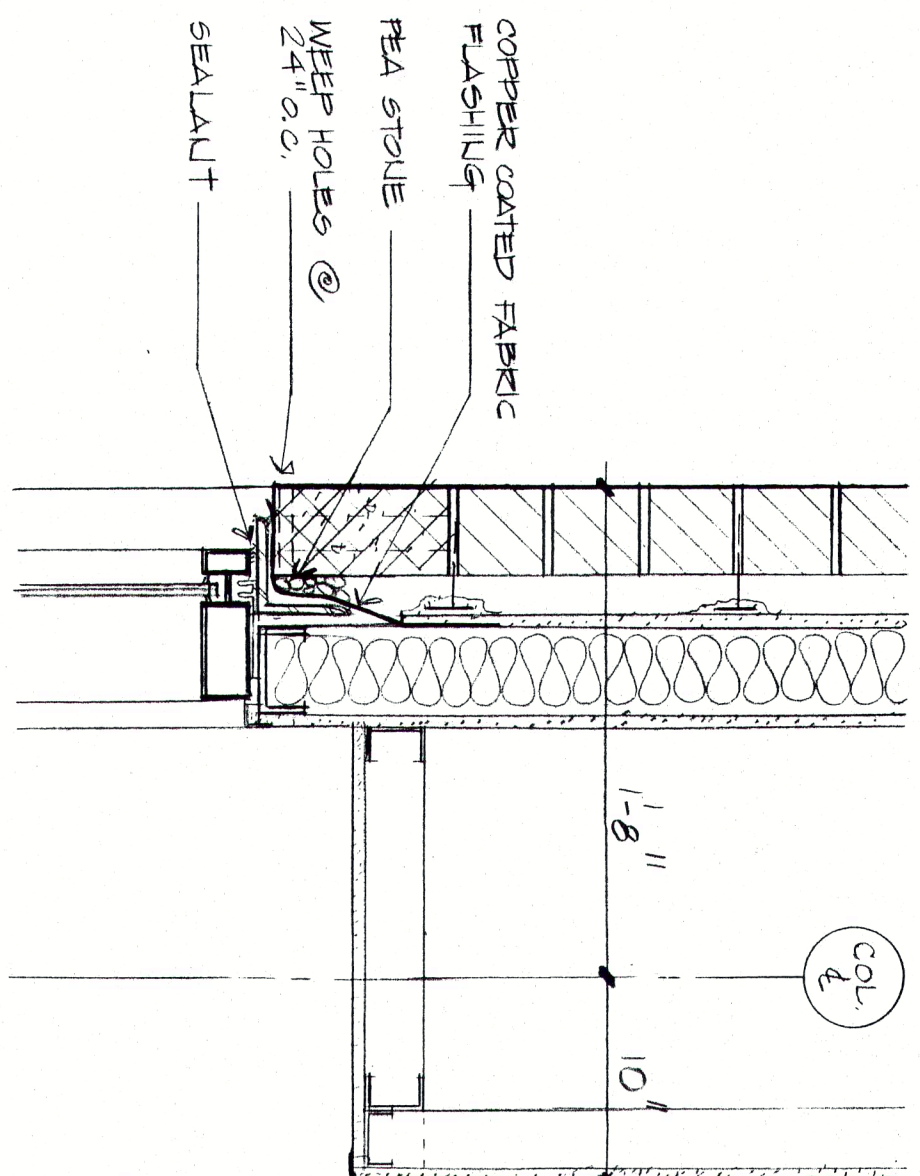


13 HEAD AT WINDOW AT ATRIUM - SECOND FLOOR
1/2" = 1'-0"

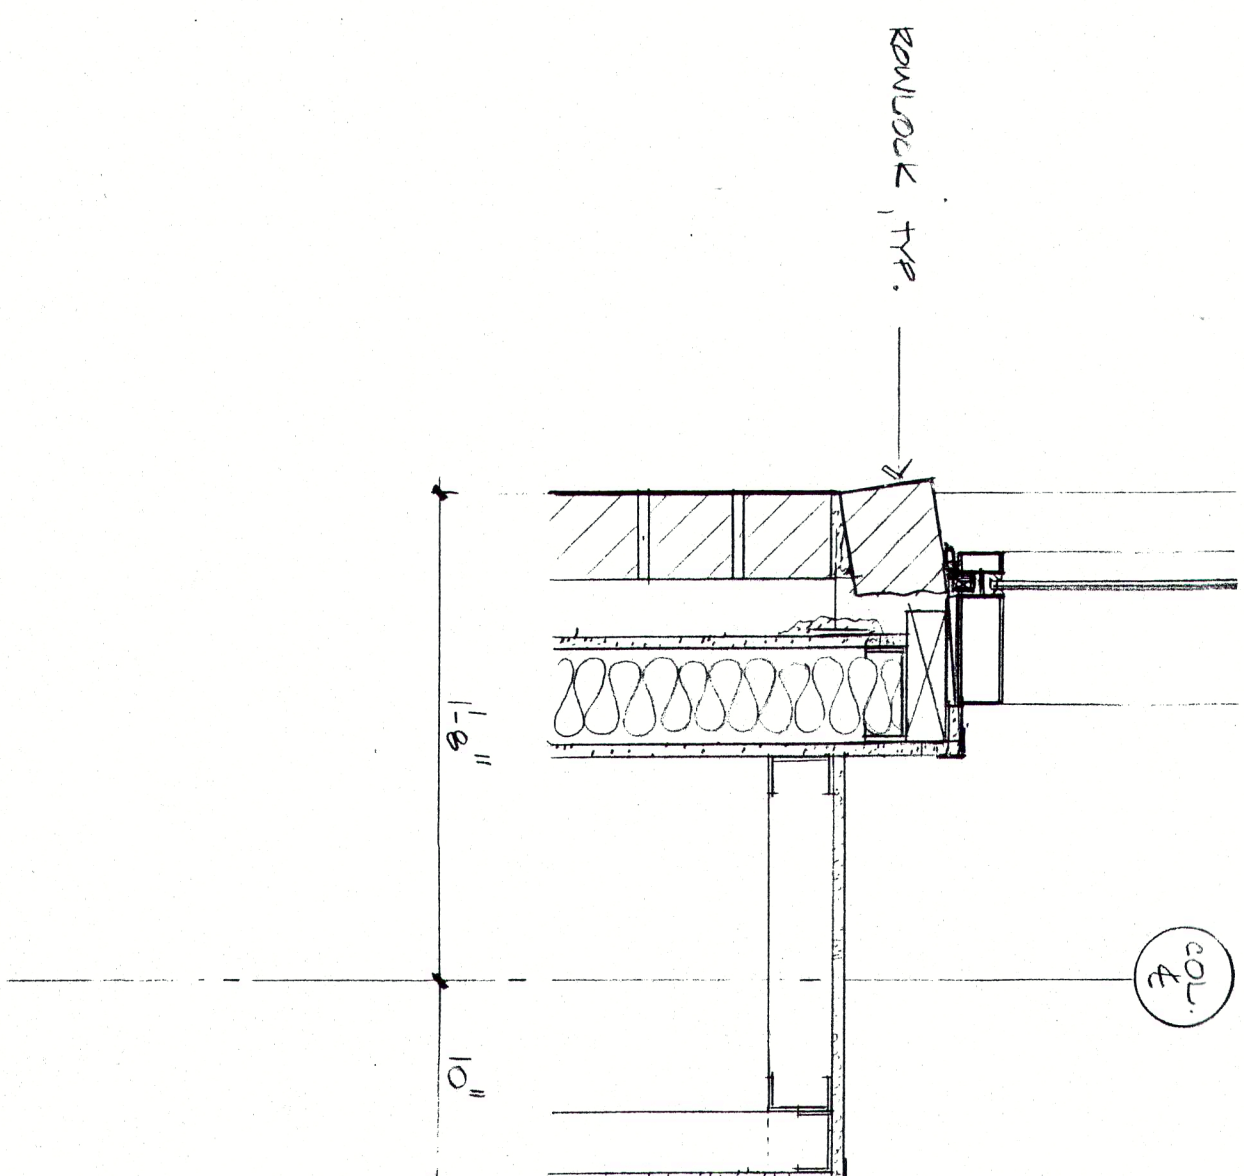


14 SILL AT WINDOW AT ATRIUM
1/2" = 1'-0"

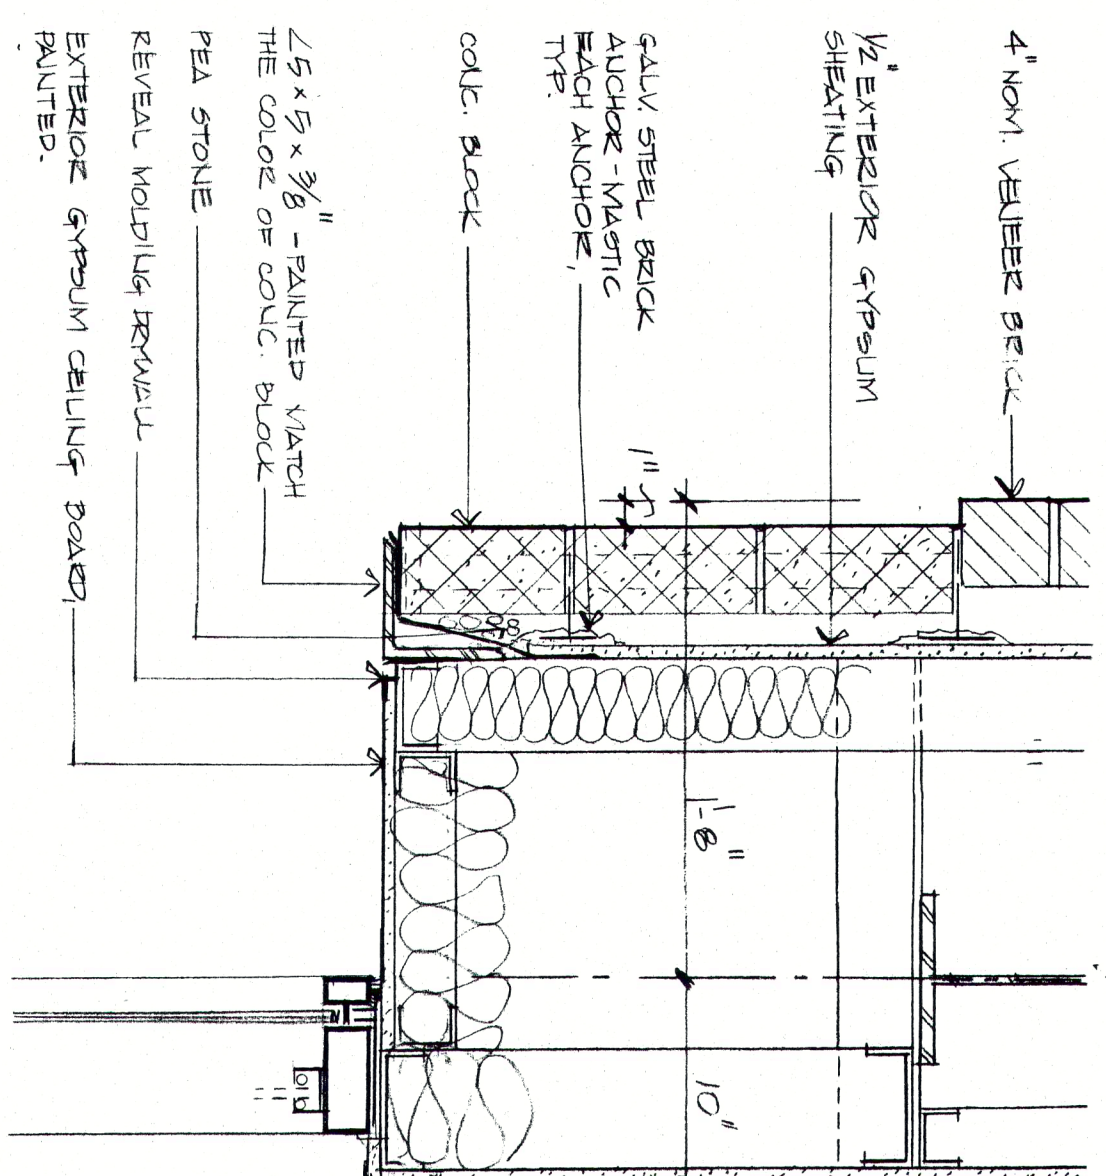


15 HEAD @ CURTAIN WALL - SOUTH ELEV.
1/2" = 1'-0"

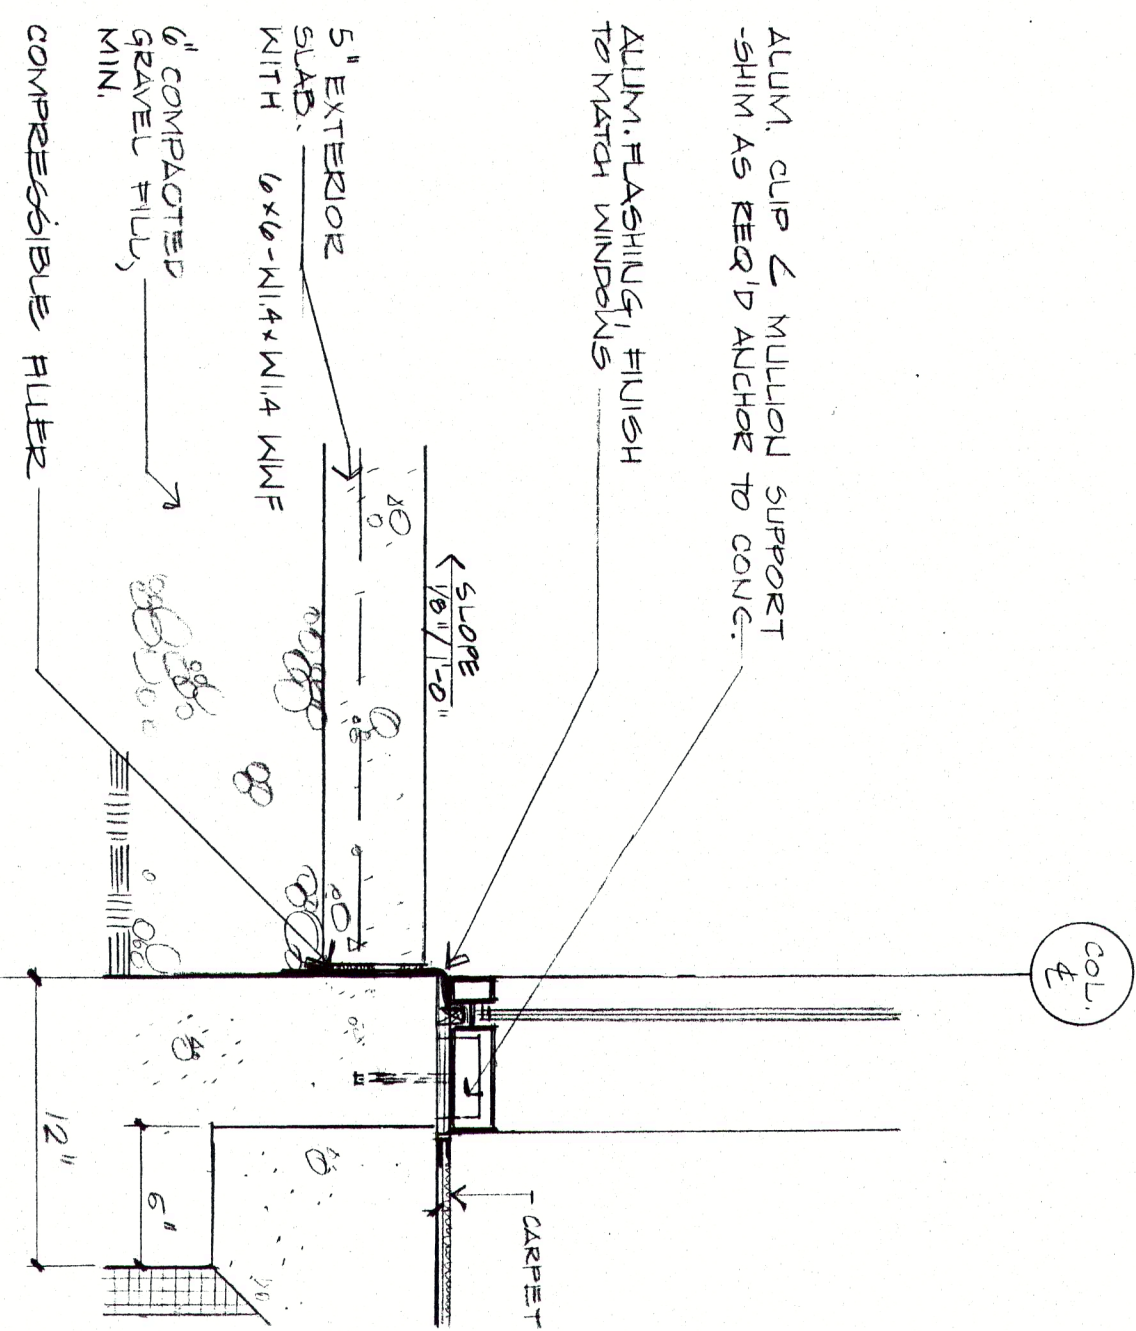


16 SILL @ CURTAIN WALL - SOUTH ELEV.
1/2" = 1'-0"

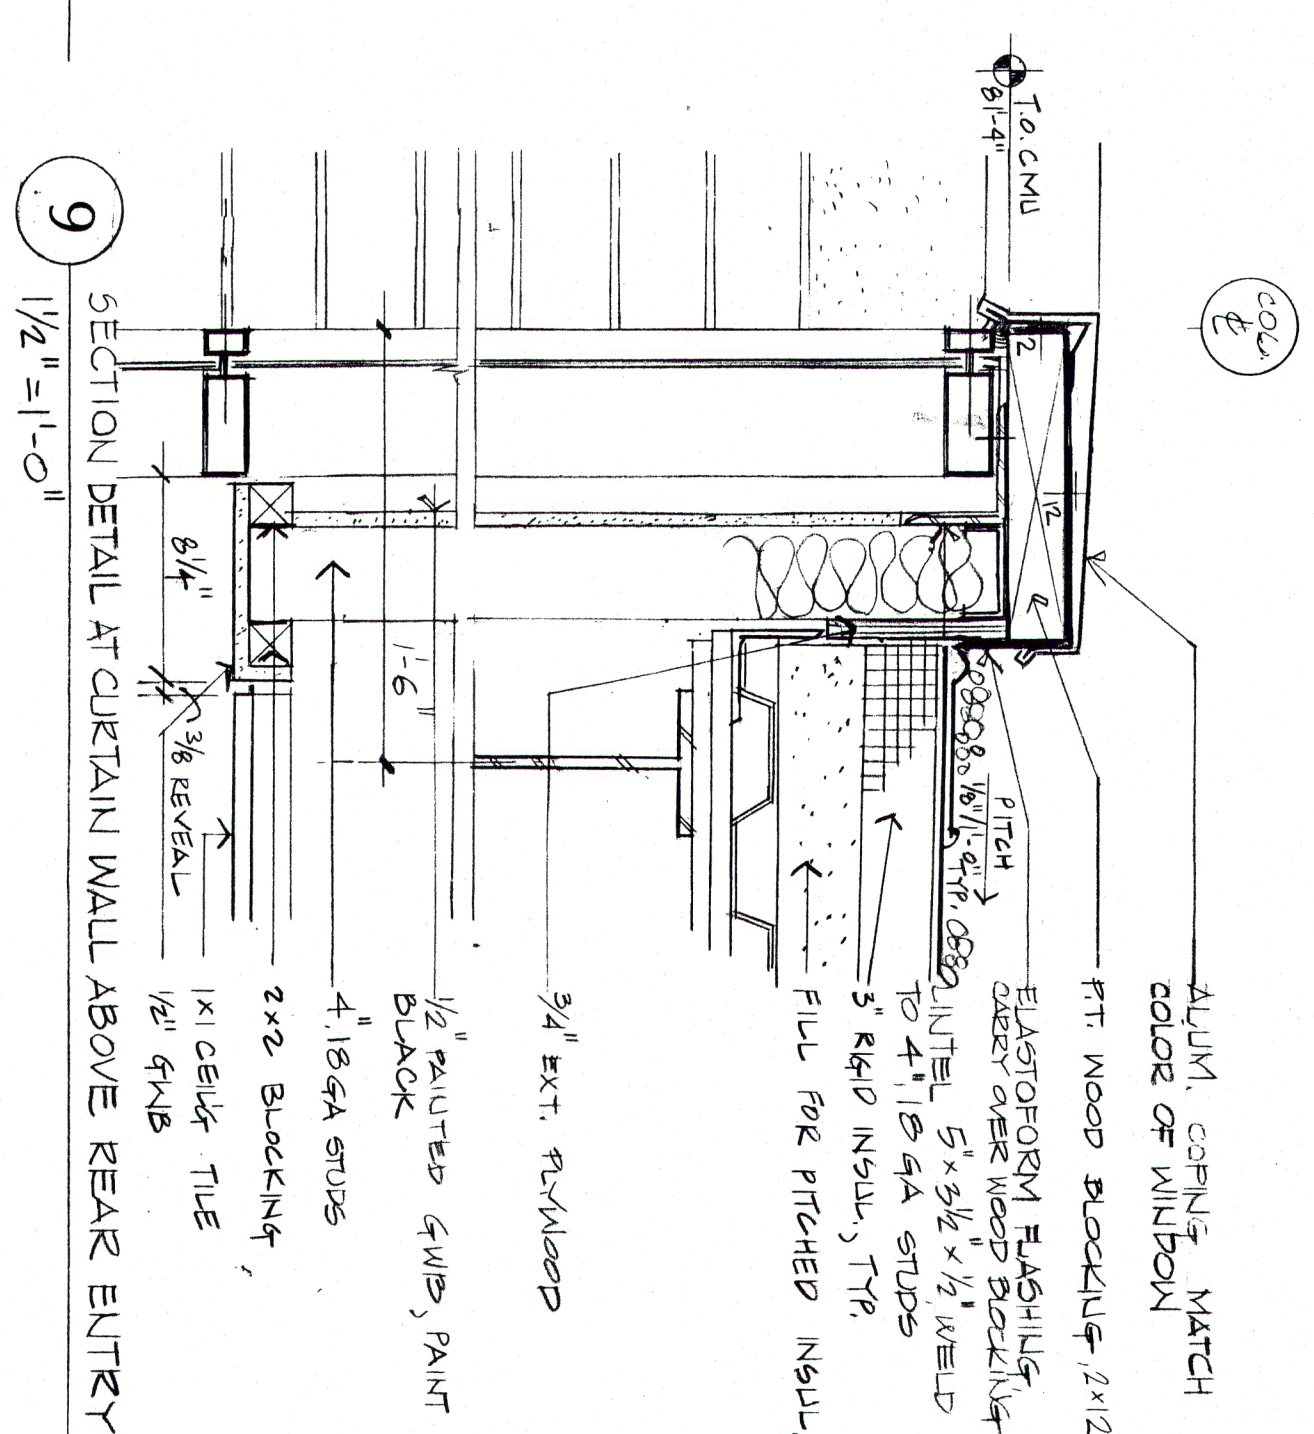


9 SECTION DETAIL AT CURTAIN WALL ABOVE REAR ENTRY
1/2" = 1'-0"

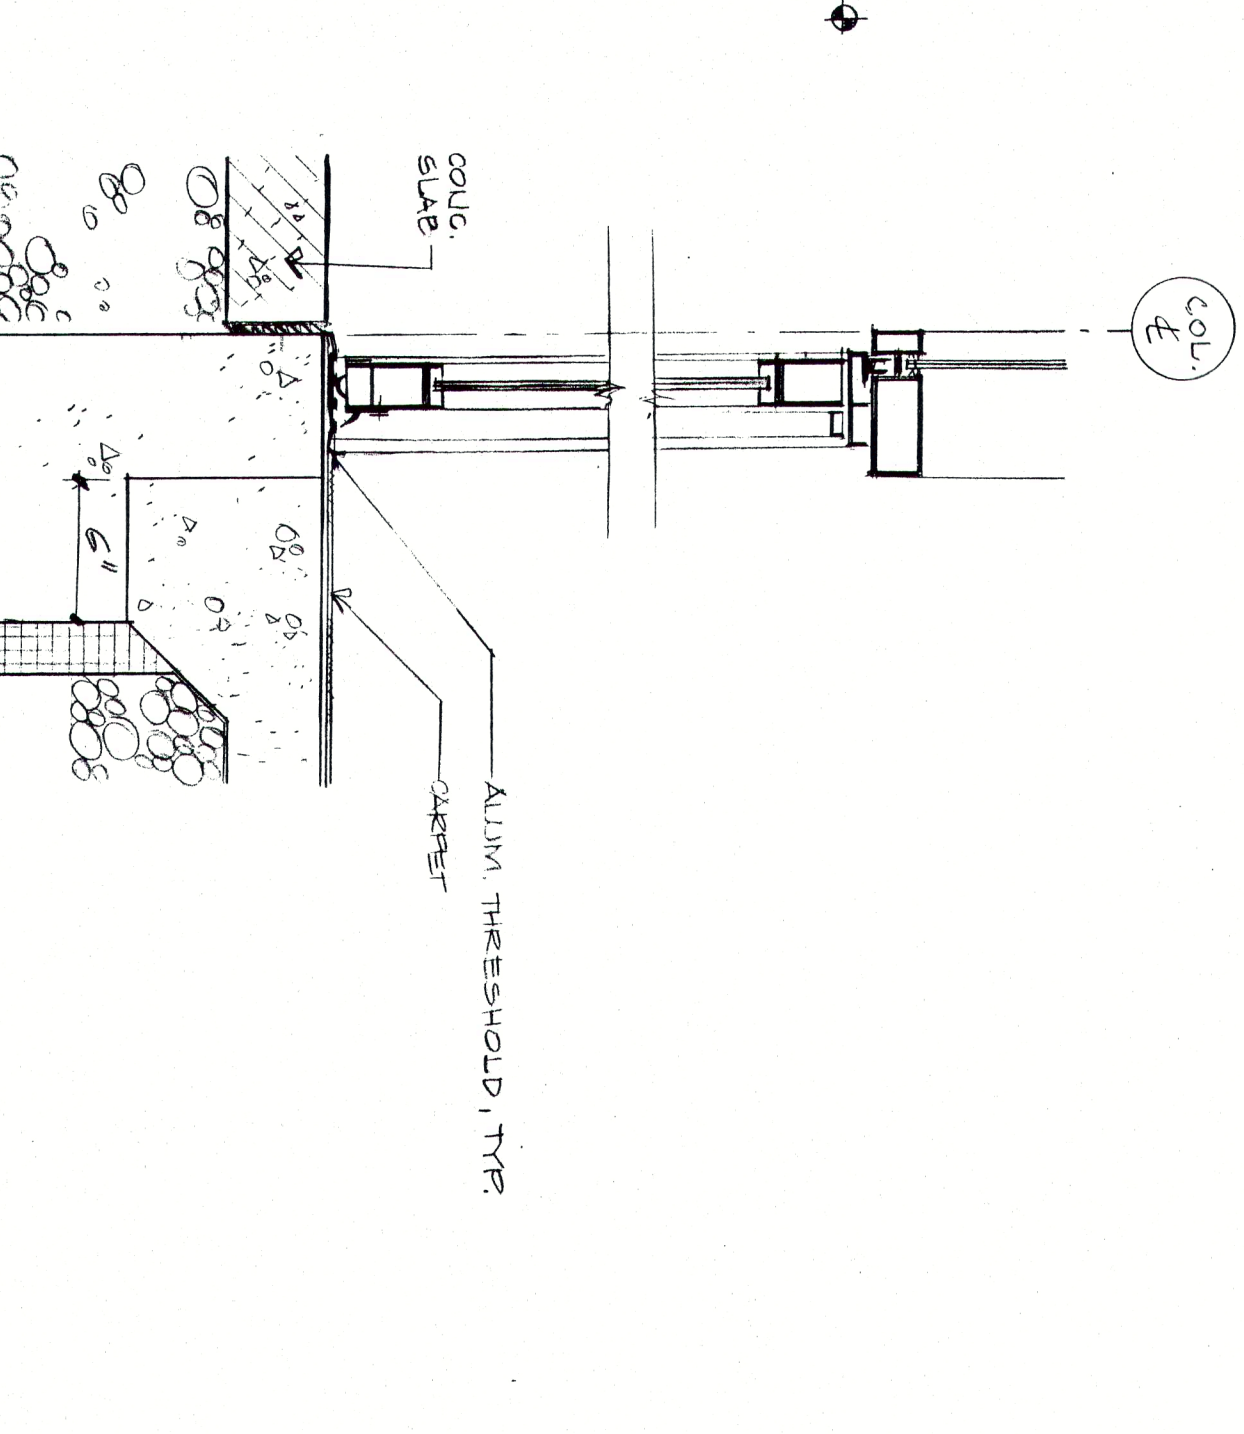


10 SECTION DETAIL AT SOUTH ENTRY
1/2" = 1'-0"

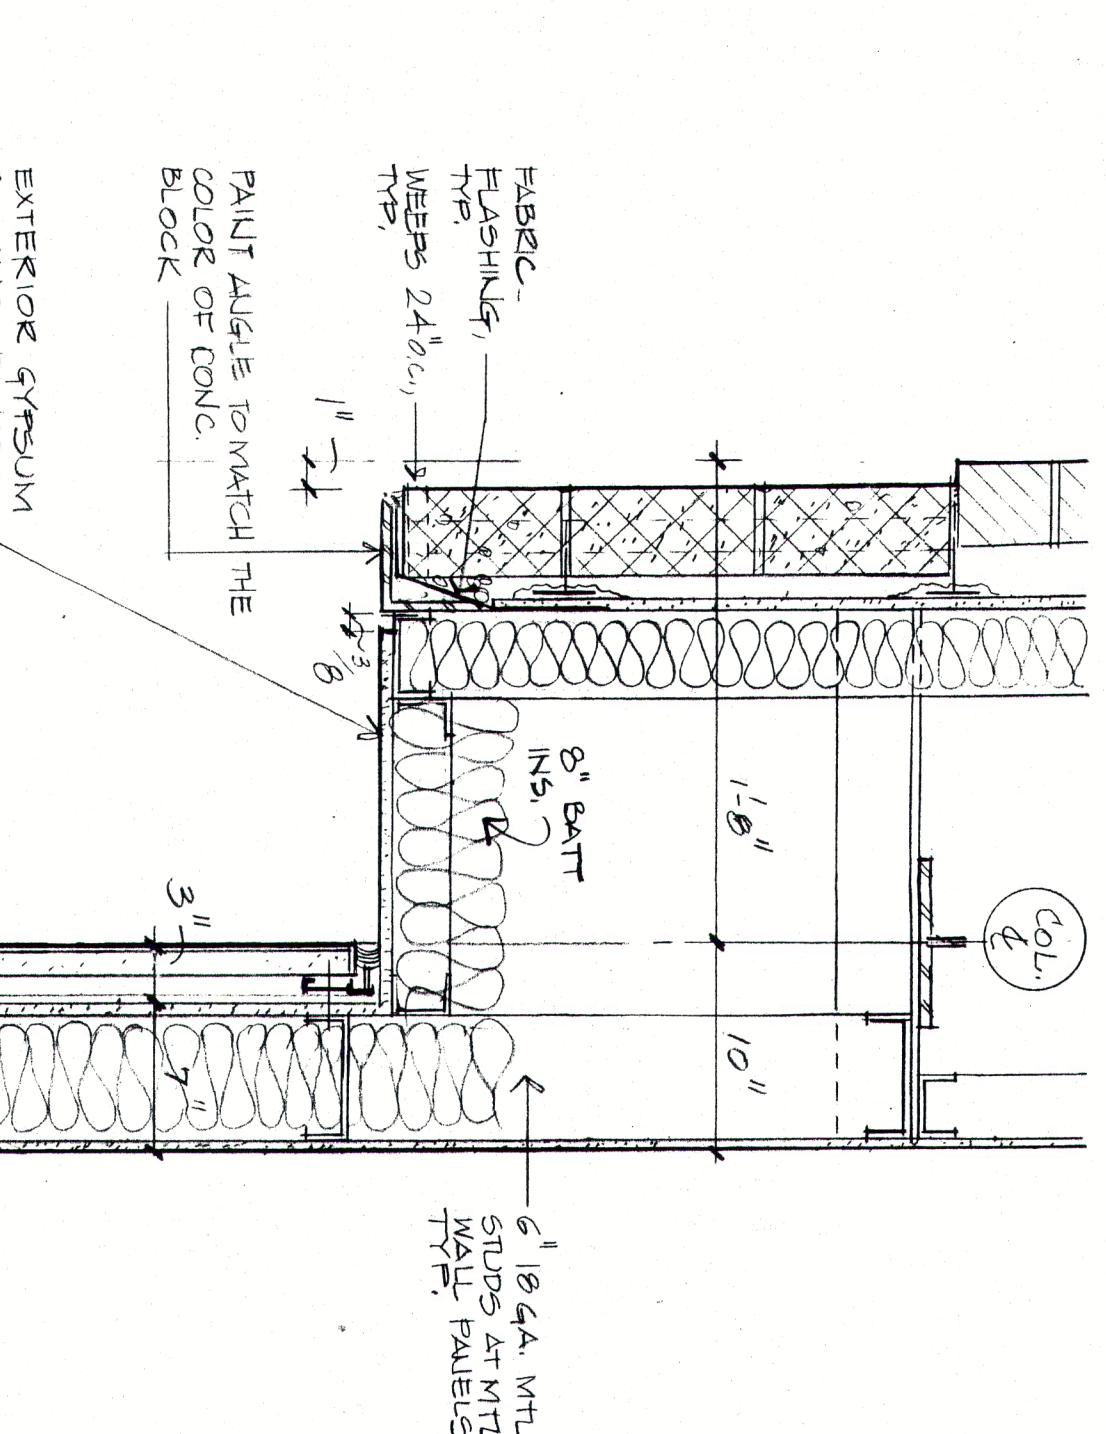


11 HEAD @ ALUM. WALL PANEL - SOUTH ELEV.
1/2" = 1'-0"

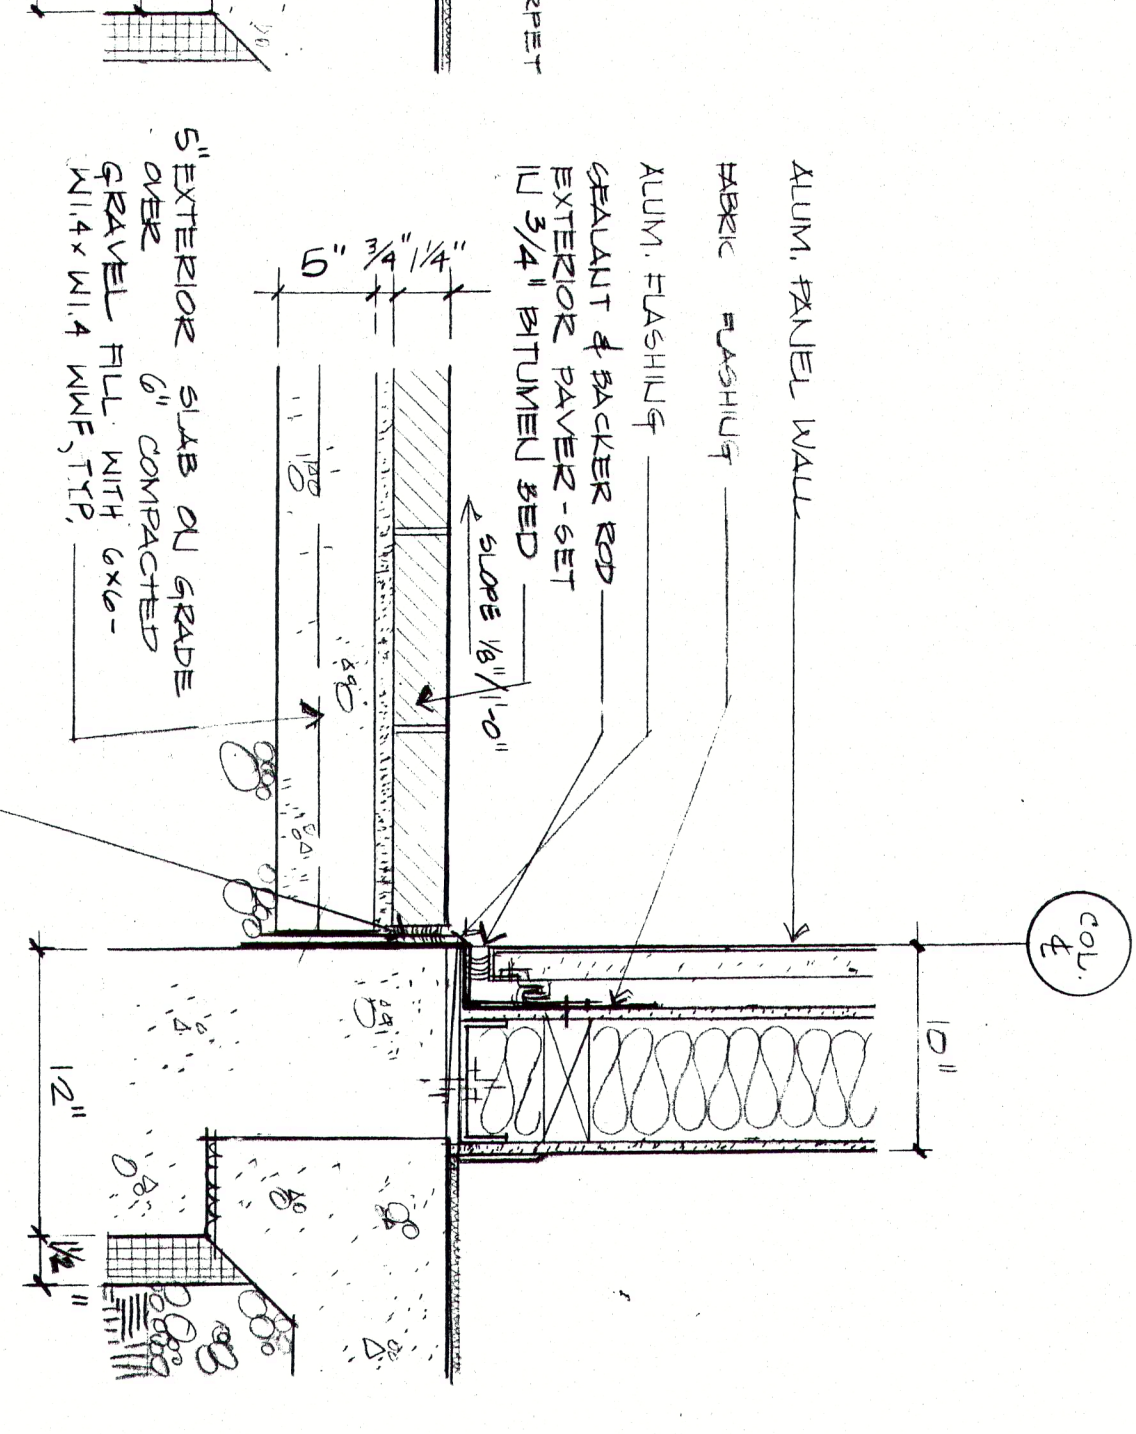


12 SILL @ METAL PANEL - SOUTH ELEV.
1/2" = 1'-0"

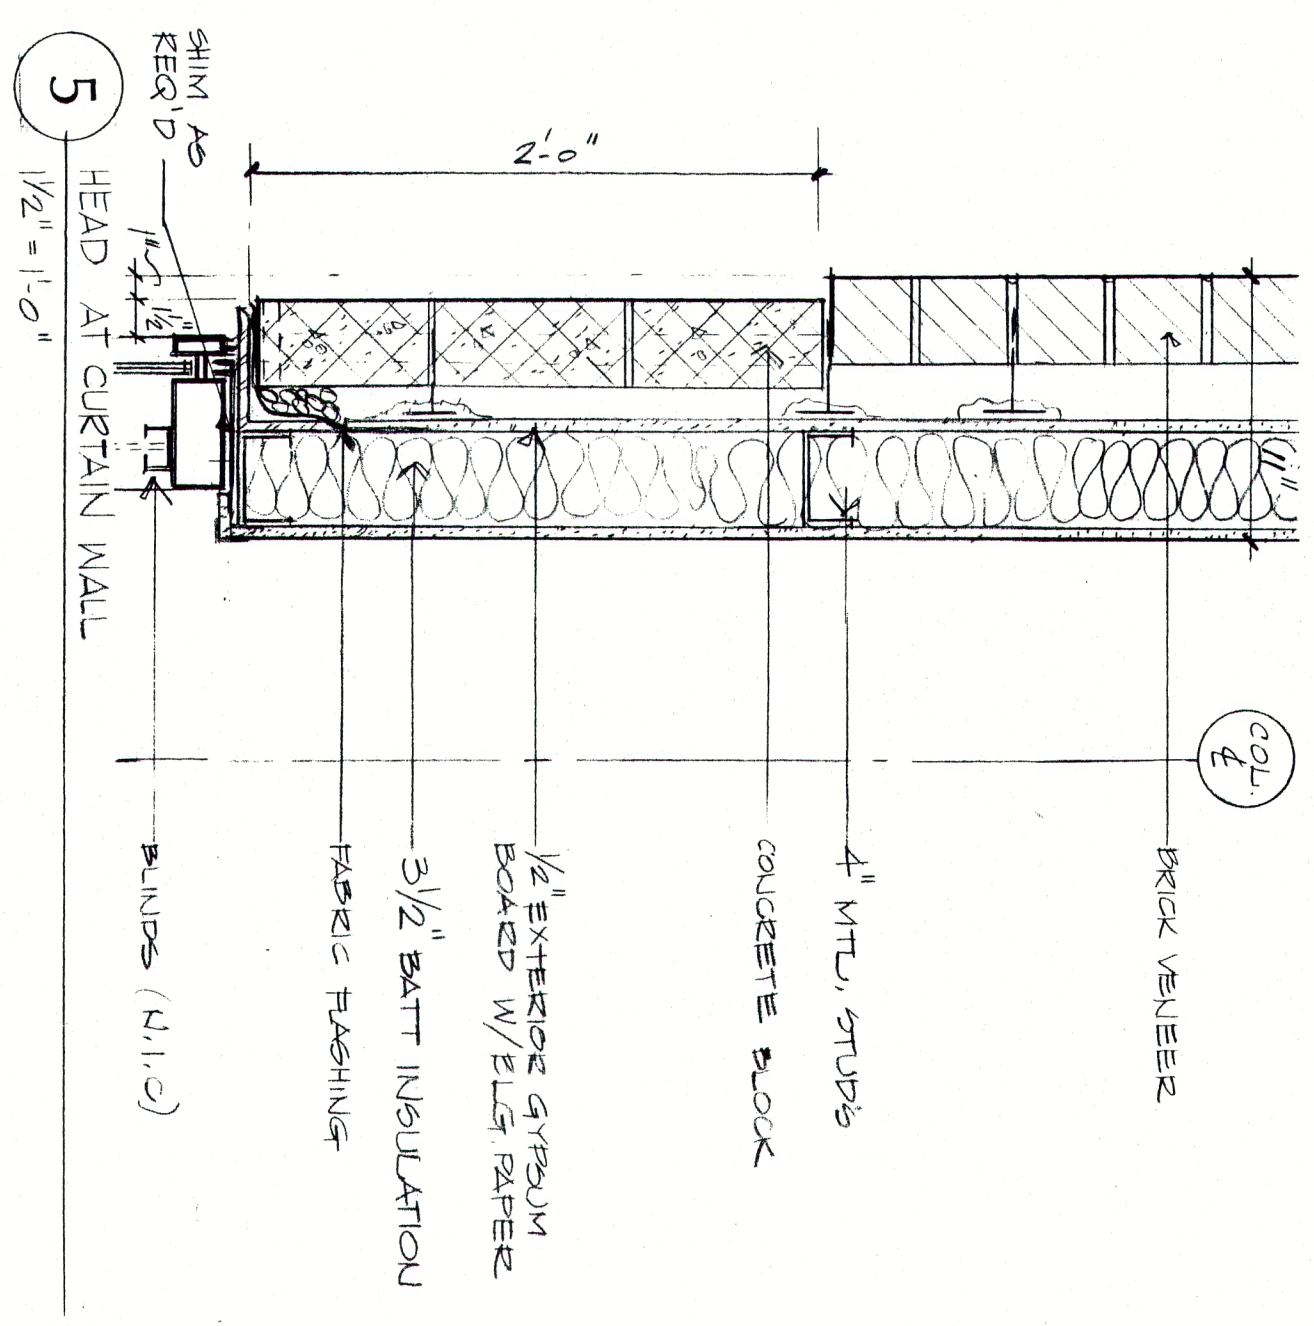


5 HEAD AT CURTAIN WALL
1/2" = 1'-0"

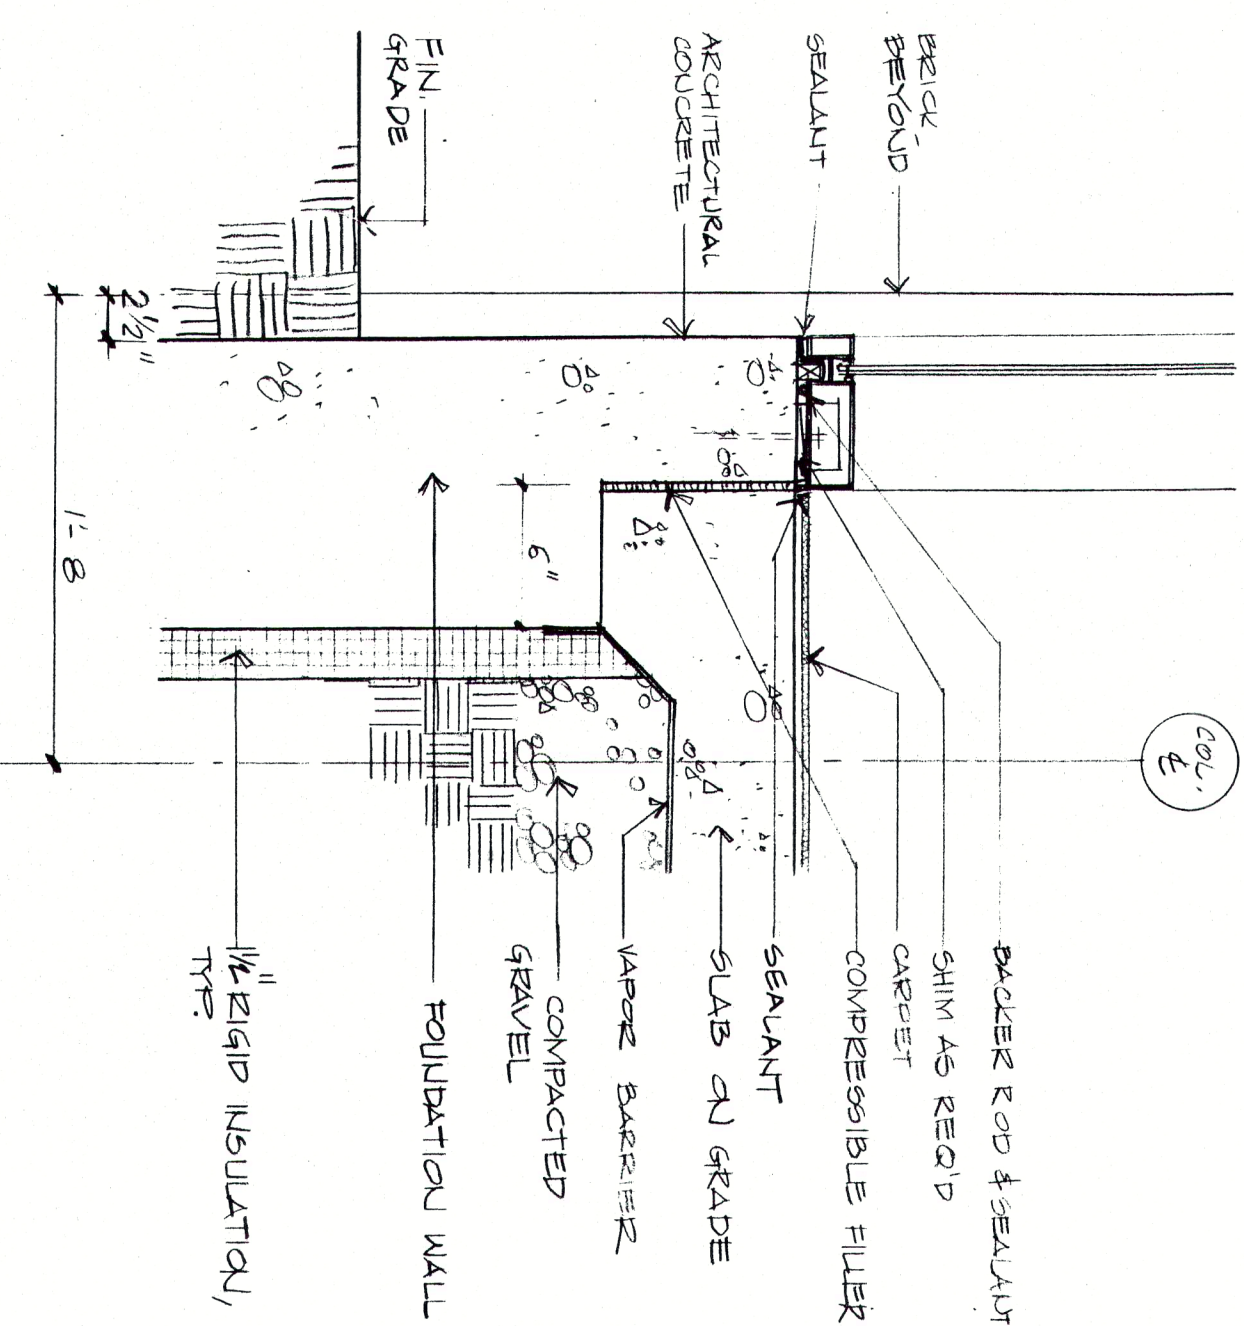


6 SILL AT CURTAIN WALL
1/2" = 1'-0"

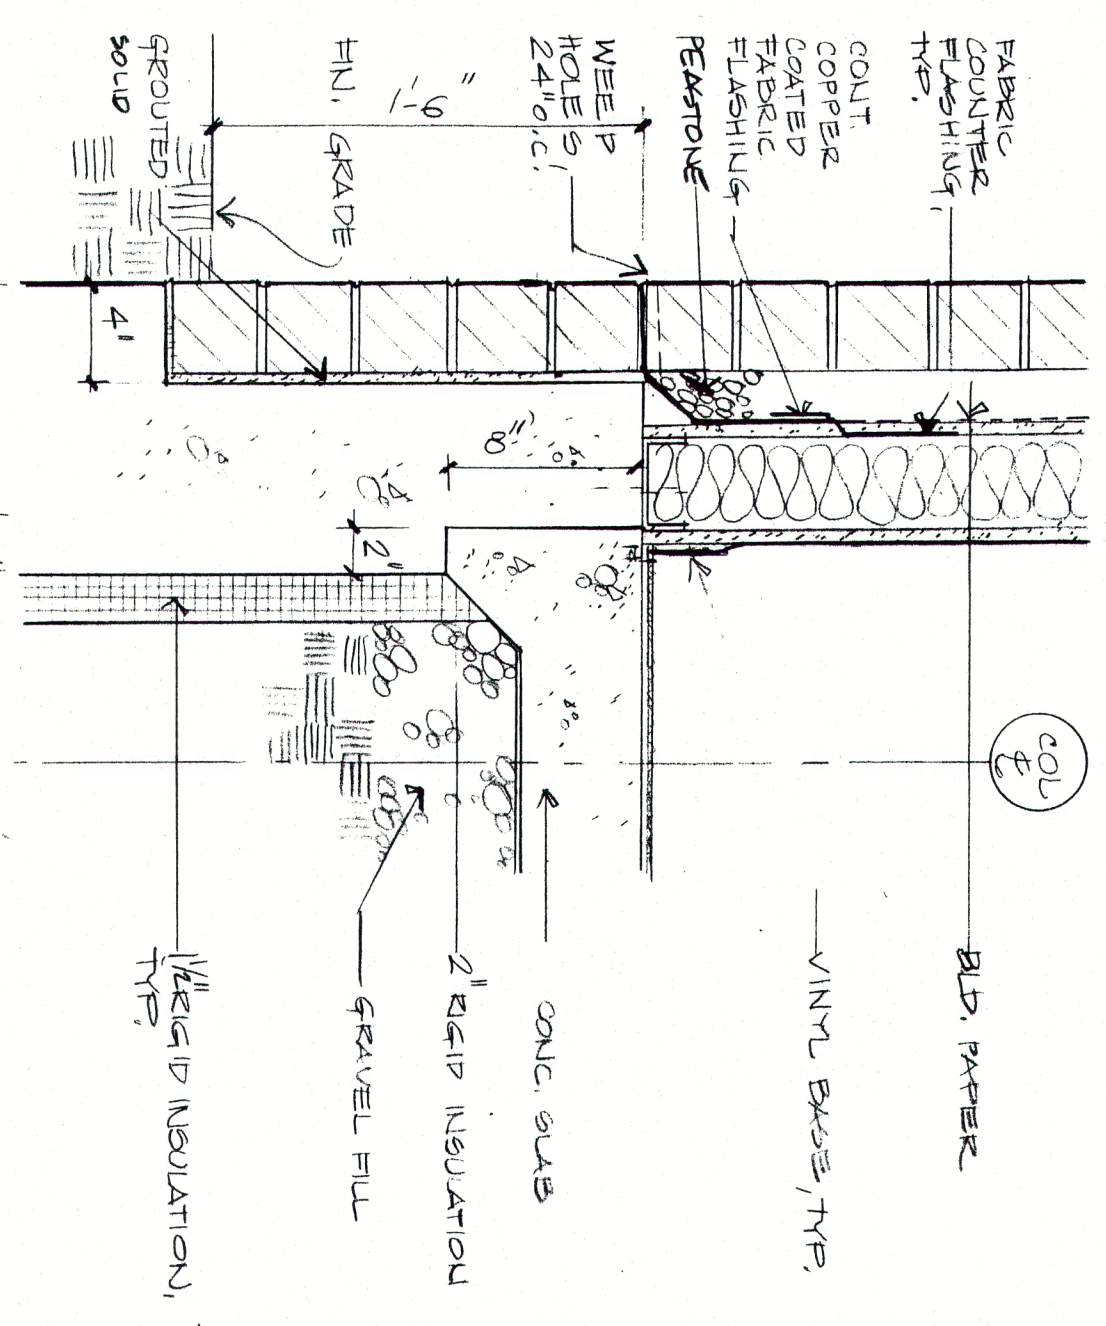


7 BRICK SHELF DETAIL @ GRADE.
1/2" = 1'-0"

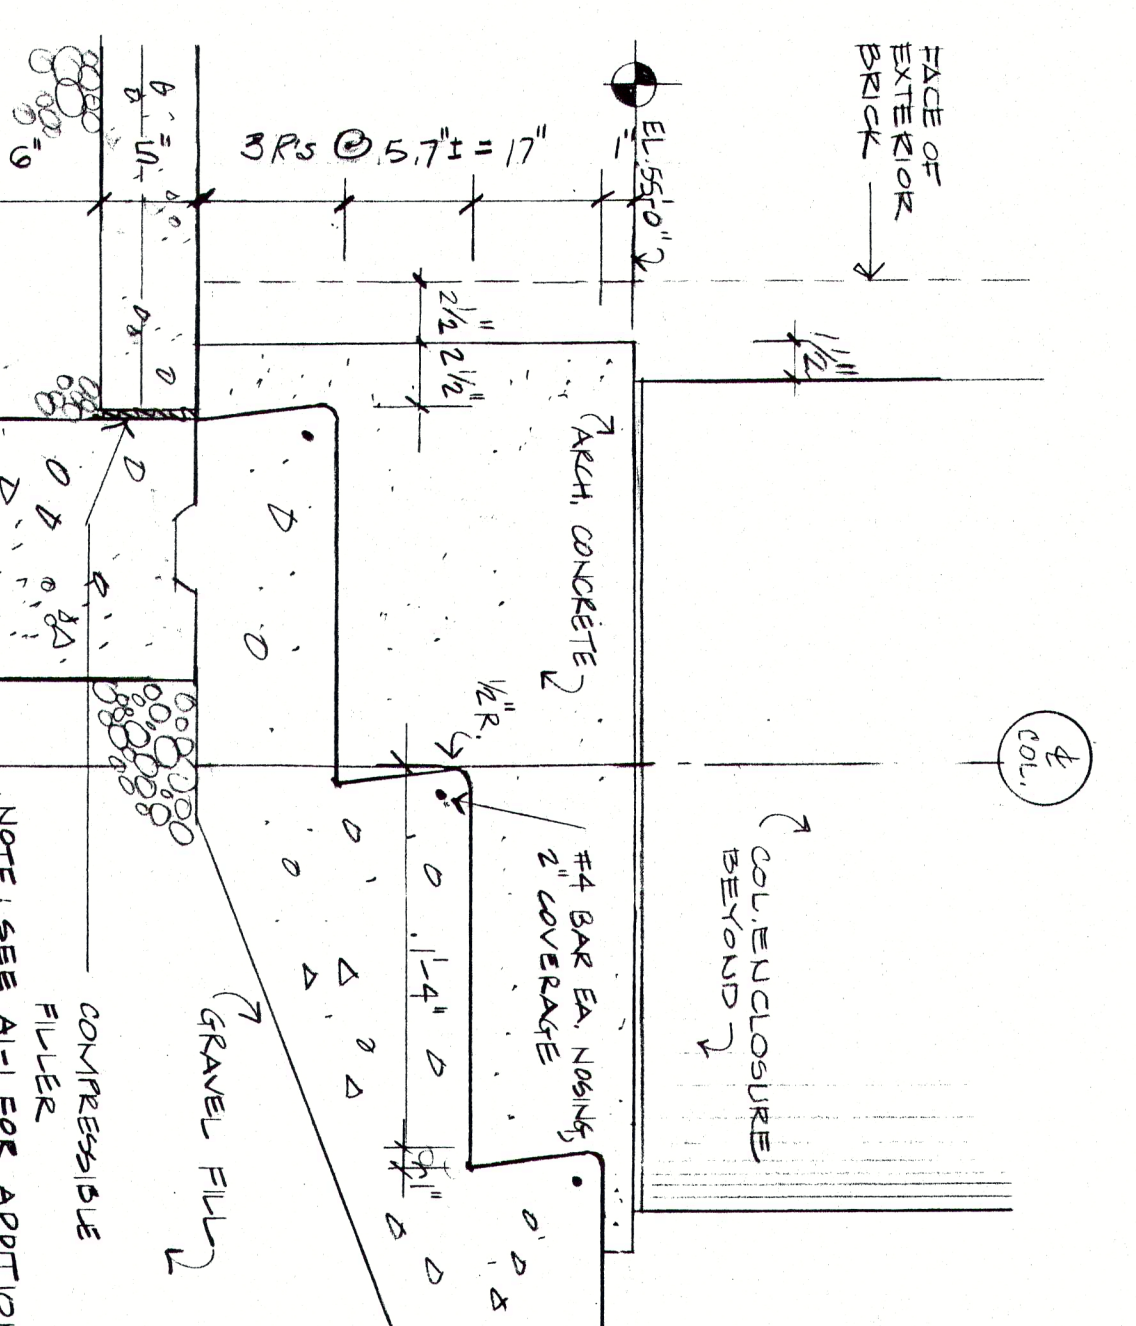


8 STAIR @ NORTH ENTRANCE
1/2" = 1'-0"

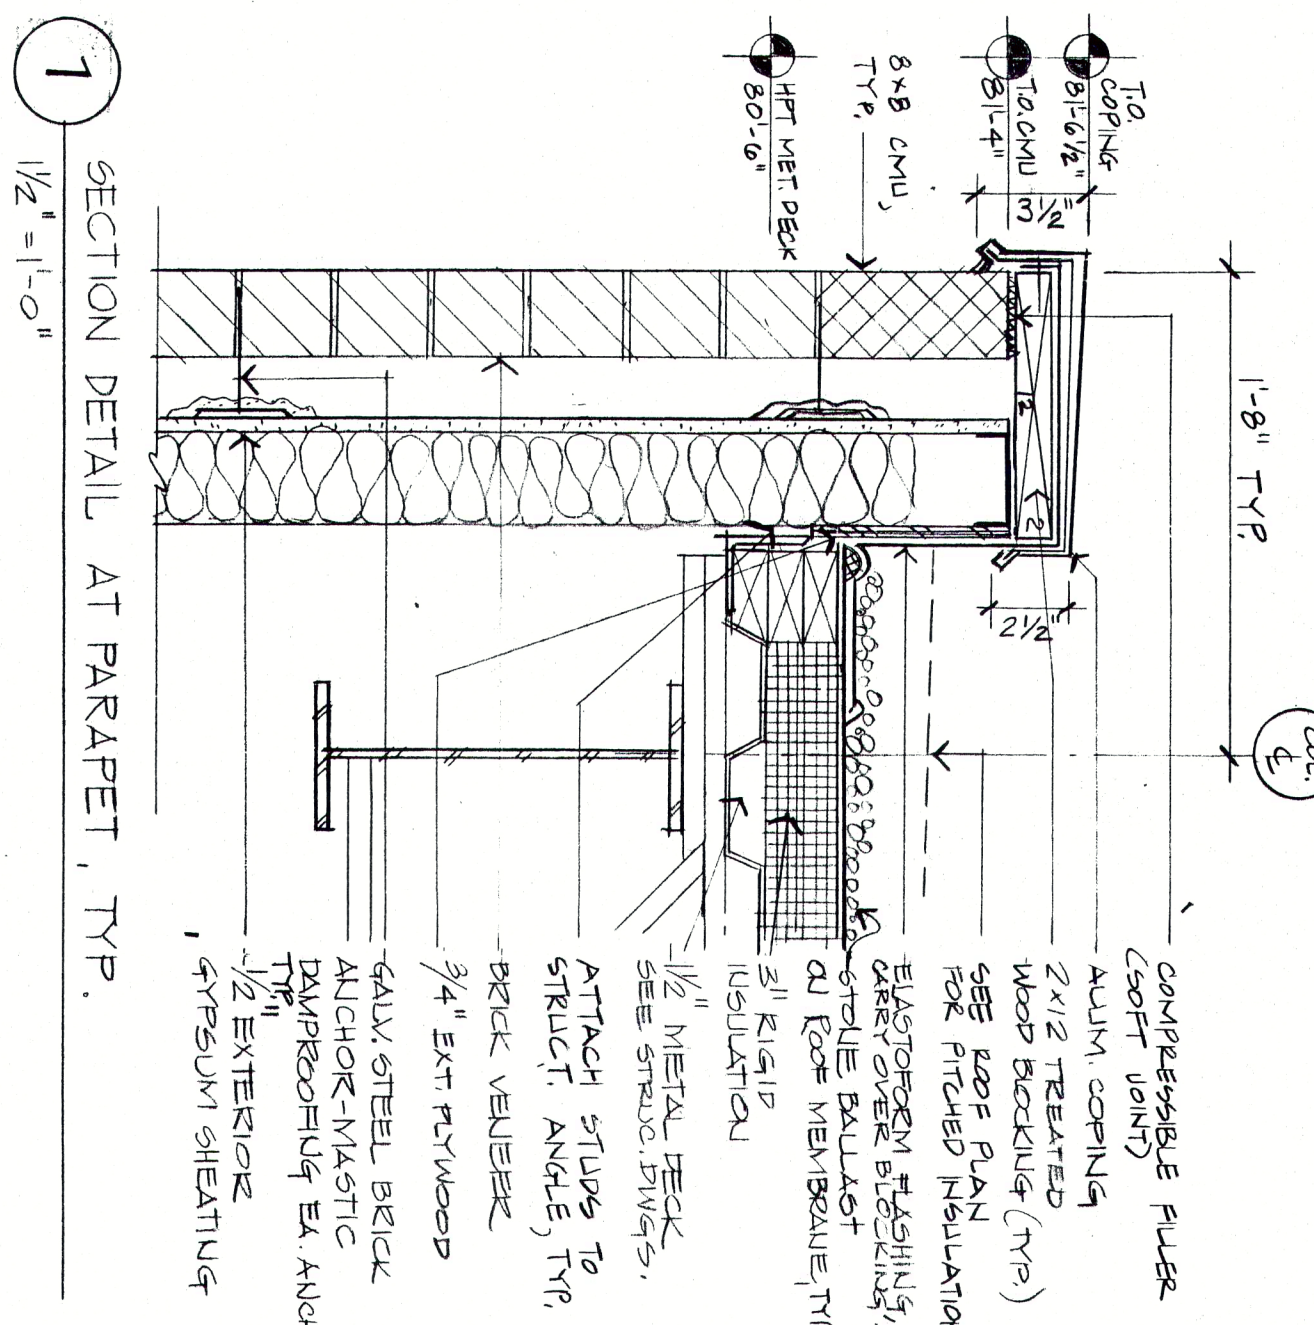


1 SECTION DETAIL AT PARAPET, TYP.
1/2" = 1'-0"

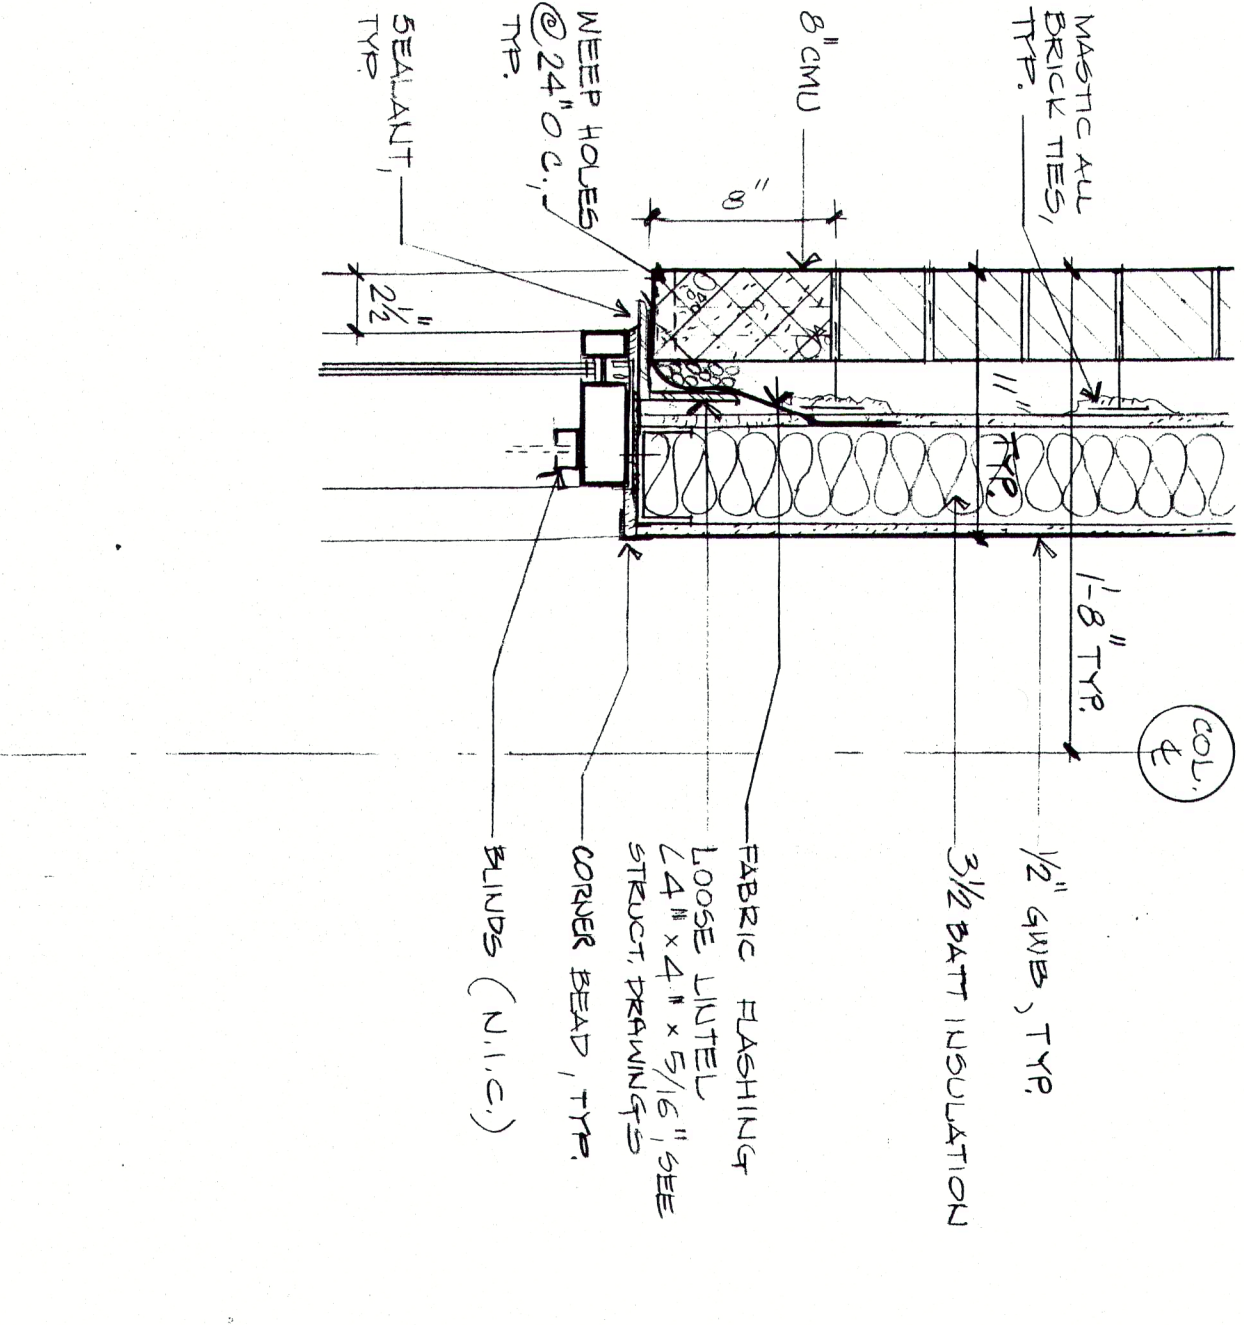

2 SECTION DETAIL AT HEAD WINDOW AT N-E & N-W ELEV.
1/2" = 1'-0"

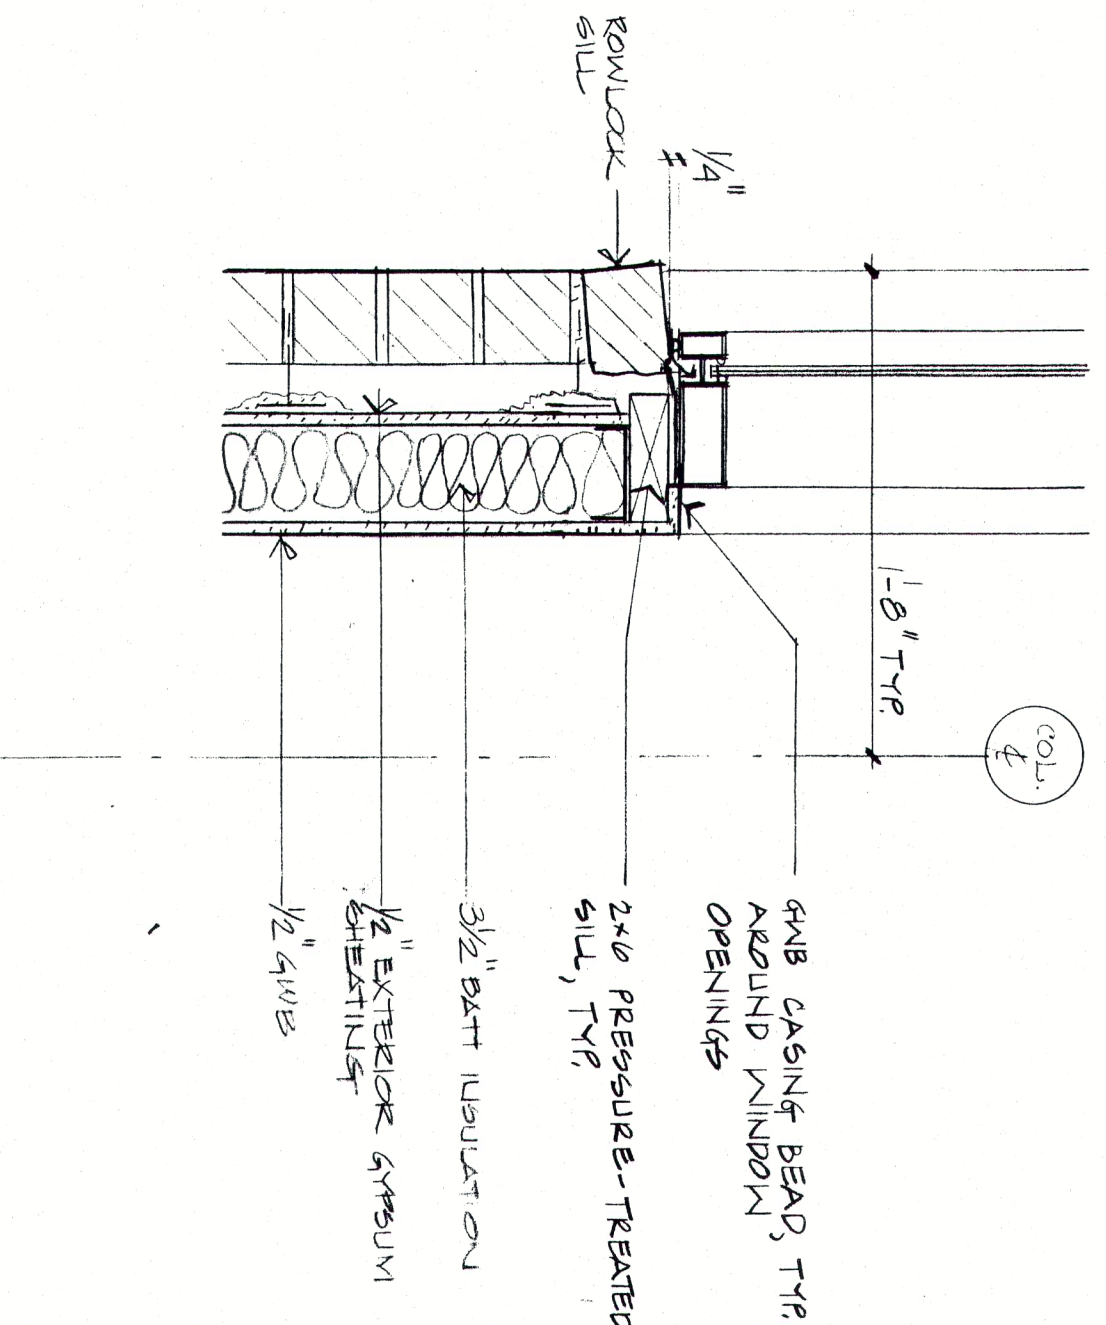

3 SECTION DETAIL AT SILL WINDOW AT N-E ELEV.
1/2" = 1'-0"

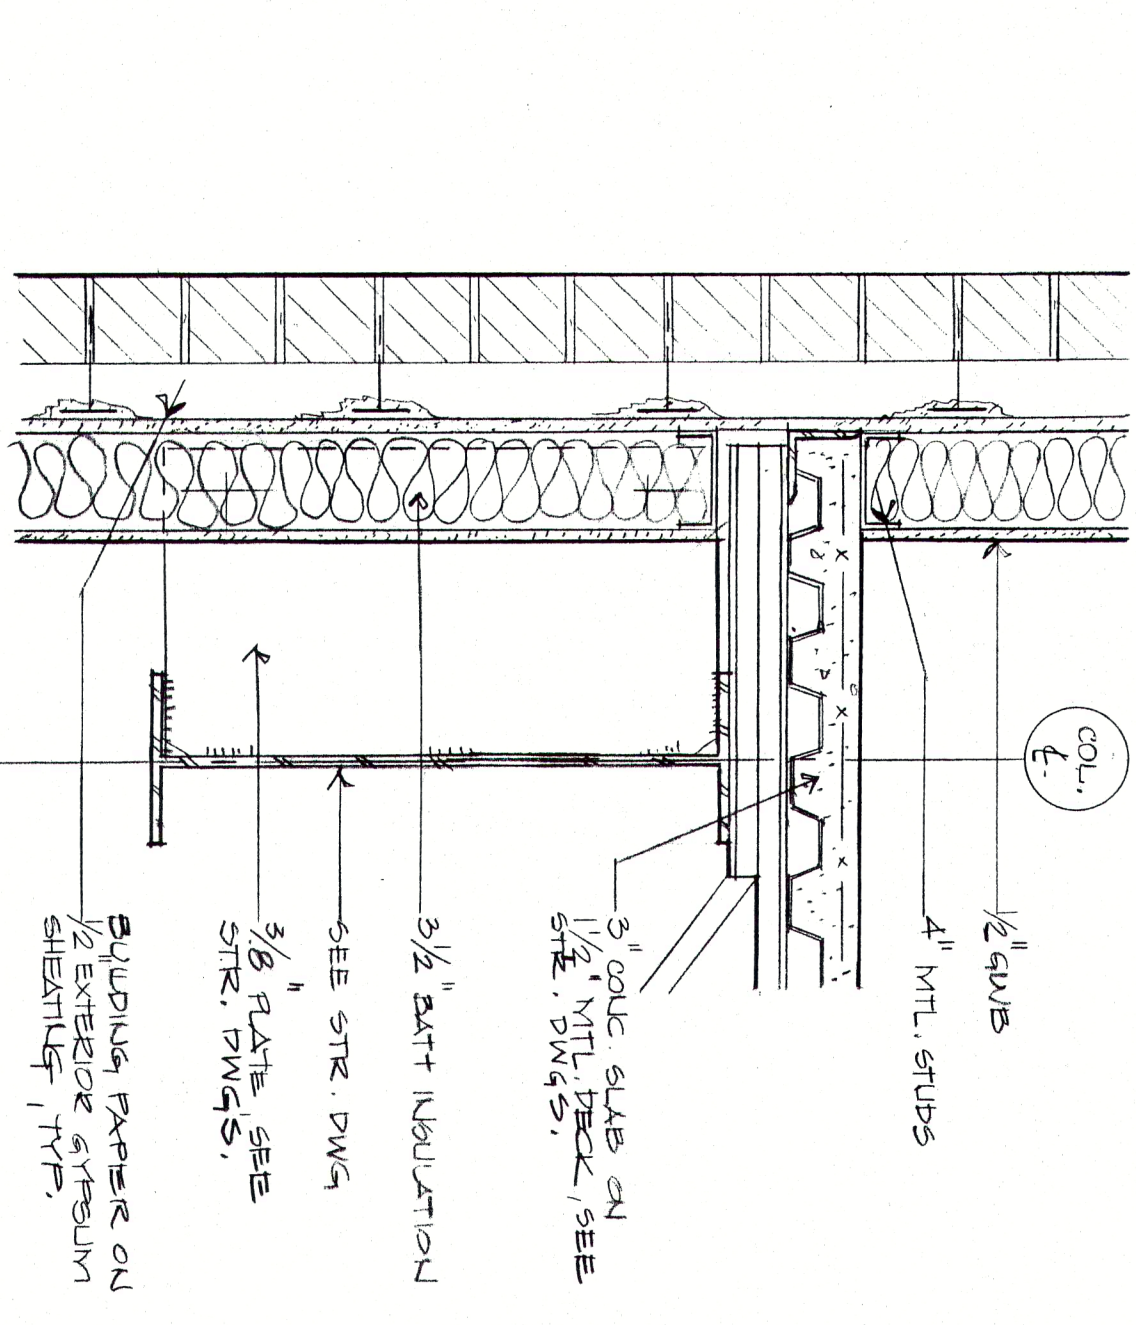

4 TYP DETAIL OF EXTERIOR @ SECOND FLOOR
1/2" = 1'-0"

Sasaki Associates, Inc.
Planning / Architecture / Landscape Architecture
100 State Street, Suite 2000, Boston, MA 02109
617.552.3300 Fax 617.552.3301

NOTES:
1. AT VERTICAL WALL PANELS PROVIDE
NECESSARY HORIZONTAL &
VERTICAL STUDS IN 6" STUDS
WITH METAL WALL COORDINATE
SUPER.
2. PROVIDE 6" 16GA STUDS BEHIND
METAL WALL PANELS, TYPICAL
3. SEE NOTE #1 ON AS-1.
